



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V602

Manufacturer Name: REV Recreation Group

Submission Date: Sep 18, 2026

NHTSA Recall No.: 26V602

Manufacturer Recall No.: 260911REV

Manufacturer Information

Population

Manufacturer Name: REV Recreation Group

Address: 1031 U.S. 224 E
P.O. Box 31
Decatur IN, 46733

Total number of potentially involved: 47

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2025-2026 American Coach American Dream

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Recreational Vehicle

Fuel / Propulsion: Compression Ignition Fuel

Production Dates: Jan 30, 2025 - Nov 25, 2025

Number of potentially involved: 6

Descriptive Information:

It was determined that there are 4 motor home products that were in question due to incorrect parameters set for overall vehicle length and other vehicle attributes. Each of the product floor plans had their wheelbase changed in the Fleetwood RV manufacturing process (lengthened or shortened) based upon the build requirements. The remedy does not represent any physical changes but rather an update to parameters in the software of the RoadWatch Safety system.

Vehicle 2: 2026-2026 FLEETWOOD PALISADE

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Recreational Vehicle

Fuel / Propulsion: Compression Ignition Fuel

Production Dates: Mar 30, 2026 - Mar 30, 2026

Number of potentially involved: 1

Descriptive Information:

It was determined that there are 4 motor home products that were in question due to incorrect parameters set for overall vehicle length and other vehicle attributes. Each of the product floor plans had their wheelbase changed in the Fleetwood RV manufacturing process (lengthened or shortened)

Part 573 Safety Recall Report

26V602

based upon the build requirements. The remedy does not represent any physical changes but rather an update to parameters in the software of the RoadWatch Safety system.

Vehicle 3: 2026-2026 Holiday Rambler Armada

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Recreational Vehicle

Fuel / Propulsion: Compression Ignition Fuel

Production Dates: May 28, 2025 - Mar 27, 2026

Number of potentially involved: 9

Descriptive Information:

It was determined that there are 4 motor home products that were in question due to incorrect parameters set for overall vehicle length and other vehicle attributes. Each of the product floor plans had their wheelbase changed in the Fleetwood RV manufacturing process (lengthened or shortened) based upon the build requirements. The remedy does not represent any physical changes but rather an update to parameters in the software of the RoadWatch Safety system.

Vehicle 4: 2026-2027 Fleetwood Discovery LXE

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Recreational Vehicle

Fuel / Propulsion: Compression Ignition Fuel

Production Dates: May 28, 2025 - Apr 23, 2026

Number of potentially involved: 31

Descriptive Information:

It was determined that there are 4 motor home products that were in question due to incorrect parameters set for overall vehicle length and other vehicle attributes. Each of the product floor plans had their wheelbase changed in the Fleetwood RV manufacturing process (lengthened or shortened) based upon the build requirements. The remedy does not represent any physical changes but rather an update to parameters in the software of the RoadWatch Safety system.

Defect / Noncompliance Description

Description of the defect or noncompliance:

On certain Model Year 2025, 2026 & 2027 Fleetwood, Holiday Rambler and American Coach motorhomes with the Freightliner RoadWatch Safety system (components provided by ZF WABCO), the system may not function properly due to incorrect parameters set for overall vehicle length and other vehicle attributes.

FMVSS1:

Part 573 Safety Recall Report

26V602**FMVSS2:****Description of the safety risk, including crash, fire, death, injury:**

Loss of proper system function while driving may result in a crash.

Description of the cause:

The RoadWatch Safety system may not function properly due to incorrect parameters set for overall vehicle length and other vehicle attributes.

Identification of any warning that can occur:

A dash indicator light may appear.

Component Manufacturer

Tier of Supplier: Tier 2**Supplier Type:** Distributor**Name:** ZF Wabco**Address:** Obere Weiden 12
Schweinfurt Foreign States, 97424**Country:** Germany**Tier of Supplier:** Tier 1**Supplier Type:****Name:** Freightliner Custom Chassis Corporation**Address:** 552 Hyatt Street
Gaffney SC, 29341**Country:** United States

Involved Components

Component Name 1: ABS ECU**Component Description:** Non-Tag ECU**Component Part Number:** 4008629000**Component Name 2:** ABS ECU**Component Description:** Tag ECU

Part 573 Safety Recall Report

26V602

Component Part Number: 4008629010

Chronology

April 9, 2026 - Freightliner Custom Chassis communicated to a Fleetwood RV manufacturing associate that the programming file for the RoadWatch Safety system provided by FCCC may not have been correct for the overall vehicle length and other vehicle parameters.

April 13 Freightliner conducted an onsite meeting at Fleetwood. Fleetwood began internal discussions.

May 14 It was determined that there are 4 motor home products that were in question for this issue. Each of the product floor plans had their wheelbase changed in the Fleetwood RV manufacturing process (lengthened or shortened) based upon the build requirements. The associated product floor plans are American Dream 42 Q, Discovery LXE 40 M, Armada 40 M and Palisade 40 H.

June Fleetwood requested analysis from Freightliner and WABCO. Meetings were held with key team members about programming questions.

July and August

Stock units were evaluated as part of the ongoing investigation. This required collaboration with Freightliner field techs and/or dealers to reprogram the RoadWatch Safety system with correct vehicle parameters as necessary.

August 31 Meeting to discuss a recovery plan. The issue that may present itself to the driver is still not fully understood. The concern is that the system may not be programmed with the correct overall vehicle length or other vehicle parameters, and that if the system does not have this information programmed, it could behave in an unpredictable manner during system activation events.

September 9 Fleetwood is unaware of any claims or complaints regarding the RoadWatch Safety system. Fleetwood's Safety Team met and discussed the investigation findings, recommending a bulletin to address the motor homes in the field due to the uncertain behavior that may result during system activation events.

September 11 Sent to Corporate Compliance for review and consideration.

September 17 DIR Approval to proceed with Part 573 Safety Recall Report.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type:

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Fleetwood will send a recall notification to customers and dealers of the need to have certain motor home RoadWatch Safety systems parameters confirmed and reprogrammed if necessary at a

Part 573 Safety Recall Report

26V602

Freightliner dealer. Dealers and /or customers will need to take their motor home to a Freightliner dealer. By reprogramming, any potential issue will be resolved.

How remedy component differs from recalled component:

The remedy does not represent any physical changes but rather an update to parameters in the software of the RoadWatch Safety system.

Identify how/when recall condition was corrected in production:

Fleetwood ensured that the correct vehicle parameters were being programmed in production as of April 24, 2026.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Dealer notifications will be conducted via email on or before 11.16.26
Owner notifications will be conducted via US mail on or before 11.16.26.

Planned Dealer Notification Date: Nov 13, 2026 - Nov 13, 2026

☐ No Dealers

Planned Interim Owner Notification Date:

☐ No Owners

Planned Remedy Owner Notification Date: Nov 16, 2026 - Nov 16, 2026

☐ Phased Recall

Date when VIN will be searchable: