



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V623

Manufacturer Name: Chrysler (FCA US, LLC)

Submission Date: Sep 29, 2026

NHTSA Recall No.: 26V623

Manufacturer Recall No.: 51D

Manufacturer Information

Population

Manufacturer Name: Chrysler (FCA US, LLC)

Address: 800 Chrysler Drive
CIMS 482-00-91
Auburn Hills MI, 48326-
2757

Total number of potentially involved: 16,385

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 RAM 1500

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Jul 01, 2025 - Mar 17, 2026

Number of potentially involved: 16,385

Descriptive Information:

Some 2026MY Ram 1500 vehicles may experience an incorrectly functioning tire pressure monitoring system ("TPMS") sensor which may report a false tire pressure.

The suspect period began July 1, 2025, when a process change was made in the tire and wheel assembly, and ended on March 17, 2026, when the tire and wheel assembly process was updated. The suspect period was determined using supplier and vehicle production records.

Similar vehicles not included in this recall were built before or after the suspect period, with tire and wheel assemblies produced by a different supplier or have reached a minimum level of maturity.

Defect / Noncompliance Description

Description of the defect or noncompliance:

Federal Motor Vehicle Safety Standard ("FMVSS") 571.138 states that "...each vehicle must be equipped with a tire pressure monitor system" that detects "when one or more of a vehicles tires is significantly under-inflated and illuminates a low tire pressure warning telltale." The tire pressure system in the suspect vehicles may not accurately report tire pressure.

Part 573 Safety Recall Report

26V623

FMVSS1: 138 - Tire pressure monitoring systems

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Inaccurate indication of tire pressure may result in tire failure, which could increase the risk of a crash.

Description of the cause:

Identification of any warning that can occur:

None prior to failure. When the failure occurs, the TPMS Telltale may illuminate.

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name: Sensata Technologies

Address: 529 Pleasant Street
Attleboro MA, 02703

Country: United States

Involved Components

Component Name 1: Tire Pressure

Component Description: Sensor

Component Part Number: 68293199AA

Chronology

- On March 17, 2026, the FCA US LLC ("FCA US") Technical Safety and Regulatory Compliance ("TSRC") organization opened an investigation into inoperative Tire Pressure Monitoring Systems in some 2026 Ram 1500 vehicles.
- Between March 2026 and August 2026, FCA US TSRC met with FCA US Engineering and Supplier Quality to review the issue, understand potential failure modes, and to determine the suspect population.
- On September 16, 2026, FCA US TSRC organization recognized that a vehicle build issue existed in some 2026 Ram 1500 vehicles potentially resulting in a noncompliance with FMVSS Nos.

Part 573 Safety Recall Report

26V623

571.138.

- On September 22, 2026, FCA US determined, through the Vehicle Regulations Committee, that a noncompliance to Federal Motor Vehicle Safety Standard No.138 exists in certain vehicles.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Replace, Inspect

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

FCA US will conduct a voluntary safety recall to inspect, and if necessary, replace the TPMS sensors.

How remedy component differs from recalled component:

The remedy component is a tire pressure sensor which was not damaged during the mounting of the tire on the rim.

Identify how/when recall condition was corrected in production:

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

****09/29/2026:** FCA US will notify dealers on or about 10/06/2026 and begin notifying owners on or about 10/27/2026.

Planned Dealer Notification Date: Oct 06, 2026 - Oct 06, 2026 ☐ No Dealers

Planned Interim Owner Notification Date: ☐ No Owners

Planned Remedy Owner Notification Date: Oct 27, 2026 - Oct 27, 2026 ☐ Phased Recall

Date when VIN will be searchable: Oct 06, 2026