

IMPORTANT SAFETY RECALL INFORMATION
**Safety Recall Campaign 0191 – Sportster S (RH1250S) Upper Triple Clamp
and Recall 0190 Kits**

To: Worldwide Dealers

Roles:

Dealer Operator, General Manager, All P&A Roles, All Service Roles, Vehicle Sales Manager

February 12, 2026

Dear Dealer:

Note: Recall 0190 is still active and all applicable motorcycles must have the upper triple clamp replaced as outlined in that bulletin prior to executing Recall 0191.

Harley-Davidson has identified a supplier error that may affect the upper triple clamp (p/n 45900365A) on certain Sportster S (RH1250S) motorcycles. Specifically, certain upper triple clamps supplied to Harley-Davidson and installed on certain Sportster S motorcycles during production or used in the Recall 0190 repair were either an outdated revision or contain a casting anomaly. These parts may be susceptible to fracture under extreme loading conditions. An upper triple clamp that fractures while the motorcycle is being operated could lead to a loss of control, which may increase the risk of a crash. Accordingly, we have voluntarily declared that this condition constitutes a safety defect to allow us to formally recall all affected motorcycles and recall kits.

Recall 0191 requires dealers to complete four actions:

1. Inspect the upper triple clamp (p/n 45900365A) on certain 2025–2026 Sportster S motorcycles built worldwide between 10/08/2025 and 01/09/2026, to determine whether the part is an outdated revision or has a casting anomaly, replace as necessary and close out Recall 0191 for that VIN. Note: This population was not previously covered by Recall 0190.
2. For motorcycles covered by Recall 0190 that have not previously had the Recall 0190 repair performed, proceed with the Recall 0190 repair per Service Bulletin M1719 using recall kit P/N 91500125 and close out both Recall 0190 and Recall 0191 for that VIN.
3. For motorcycles covered by Recall 0190 that previously *did* have the Recall 0190 repair performed, inspect the upper triple clamp for an outdated revision part or a casting anomaly, replace as necessary using recall kit P/N 91500125 and close out Recall 0191 for that VIN.
4. Inspect all Recall 0190 kits in dealer inventory to ensure they do not contain an outdated revision part or a casting anomaly.

After confirming that a motorcycle is covered by this recall, perform the recommended recall update per Service Bulletin M1719 (the “Bulletin”), which outlines the repair and credit procedures for the recall update and additional relevant information.

The recall kit (P/N 91500125) will be used for Recall 0191. As needed, recall kits will be available for order on or about 02/13/2026.

In the interest of our customers' safety, and as required by federal law, you may sell but **not deliver** any affected motorcycles until the recall remedy is complete. **Please refer to *H-Dnet / My Toolbox / Warranty Campaign Center*. Select "Safety Campaign Open VIN list," then separately select "0191" Campaigns to view the VIN lists.**

In accordance with federal regulations administered by the National Highway Traffic Safety Administration (NHTSA) and other appropriate market-specific government agencies, Harley-Davidson or authorized Harley-Davidson dealers will provide notice to all owners of record of affected products with direction to arrange for the recall service.

If you have any questions related to this recall, you can contact us at:

- U.S. dealers: Call 800-664-7762 and select the appropriate prompts
- International dealers: Contact their regional office

We take pride in the quality standards and controls we employ in our drive to lead the industry and deliver the world's most desirable motorcycles. Thank you for your cooperation.

Sincerely,

Harley-Davidson Motor Company, Inc.
Recall 0191

Key Dates:

- 02/12/2026: Service Bulletins will post to SIP
- On or about 02/19/2026: Owner notification letters begin mailing
- On or about 02/13/2026: Recall kits available for dealer order