

Dealer Service Bulletin

Safety Recall Notice

NHTSA Recall No.: [TBD]

Rossmönster Recall No.: [Internal Recall No.]

Date: [Insert Date]

Affected Vehicles

Certain 2023, 2024, and 2025 Rossmönster Baja EX and LX models equipped with Carli extended stainless-steel front brake lines within the affected VIN range.

Dealers must verify vehicle eligibility through VIN before performing recall repairs.

Condition

On certain vehicles, the front brake line mounting bracket may not have been properly secured or indexed during assembly. If improperly positioned, the brake line may contact the inside sidewall of the front tire at full steering lock.

Continued contact may cause abrasion damage to the brake line and could result in a brake fluid leak.

Safety Risk

If the brake line becomes damaged and brake fluid leaks, braking performance may be reduced, increasing the risk of a crash.

Remedy

Rossmönster will inspect the front brake line routing and mounting bracket. The brake line bracket must be:

- Properly indexed in the intended inboard position
- Properly secured
- Slip-joint properly crimped
- Verified for adequate clearance from the tire at full steering lock

If abrasion or damage to the brake line is identified, the brake line must be replaced.

All recall repairs must be performed free of charge to the customer.

Service Procedure Overview

1. Verify VIN eligibility.
2. Raise vehicle and inspect both front brake line routing and bracket positioning.
3. Turn steering from lock-to-lock to confirm adequate clearance.
4. Secure and properly index bracket as required.
5. Properly crimp slip-joint if not already secured.
6. Inspect brake line outer sleeve and braided line for abrasion or damage.
7. Replace brake line if any wear, fraying, or compromise is observed.
8. Confirm brake fluid level and proper brake function before release.

Refer to the detailed Service Procedure Attachment for torque specifications, crimp requirements, and routing diagrams.

Parts Information

Remedy components may include:

- Brake line retention hardware
- Crimp hardware
- Replacement front brake line assembly (if required)

Parts should be ordered through normal channels.

Labor Time

Inspection and securement: [X.X] hours

Brake line replacement (if required): [X.X] additional hours

Submit claims using recall code: [Recall Code]

Dealer Responsibility

- Dealers may not deliver or release any affected new or used vehicle until this recall repair has been completed.
 - Dealers must perform this recall on all affected vehicles in inventory prior to retail delivery.
 - Dealers should assist customers in scheduling repairs promptly.
-

Owner Notification

Owner notification letters will be mailed beginning [Insert Date].

If you have technical questions regarding this recall, contact Rossmönster Technical Support at:

[Phone Number]

[Email Address]

Rossmönster appreciates your cooperation in