



# NEW VEHICLE DELIVERY HOLD NOTICE

<b>DATE</b>	6/3/2026
<b>RECALL ID</b>	Kia: SC372 / NHTSA: <i>TBD</i>
<b>SUBJECT</b>	Kia is conducting a noncompliance safety recall to address a potential issue involving the driver's seat belt assembly.
<b>AFFECTED VEHICLES</b>	Certain 2027MY Kia Telluride vehicles manufactured from 3/24/2026 to 5/10/2026 and certain 2027MY Kia Telluride Hybrid vehicles manufactured from 3/24/2026 to 5/12/2026
<b>AFFECTED POPULATION</b>	Approximately 6,264 vehicles (Telluride: 1,897, Telluride Hybrid: 4,367)
<b>RECALL CONDITION</b>	The driver's seatbelt assembly in the subject vehicles may contain an incorrect vehicle sensor that, in certain conditions, causes the emergency locking retractor (ELR) to lock when attempting to extend the webbing. A seatbelt that locks when attempting to extend the webbing may be temporarily unavailable as an occupant restraint. As a result, the subject vehicles do not comply with the ELR directional rotation requirements of FMVSS 209, "Seat Belt Assemblies." An unavailable occupant restraint increases the risk of injury to an unbelted driver in the event of a collision.
<b>REMEDY</b>	When the remedy is available, dealers will replace the driver's seatbelt assembly with one containing the correct vehicle sensor.
<b>REMEDY AVAILABILITY</b>	TBD
<b>PLANNED NOTIFICATIONS</b>	Dealers will be notified in writing by no later than 7/28/2026.  Owners will be notified by first-class mail by no later than 7/31/2026.
<b>NHTSA ADVISORY</b>	<b>It is a violation of Federal law for a dealer to deliver a new motor vehicle covered by this notification under a sale or lease until the defect is remedied.</b>

If you have any questions, please contact your Kia District Parts and Service Manager.

Sincerely,

Kia North America Safety Office