

**To:** All Subaru Retailers

**From:** Subaru of America, Inc. – Service Quality

**Date:** July 17, 2026

**Re:** WRH-26 Certification Label Non-Compliance Recall- Parts update and Repair Procedure

We are happy to provide an update regarding 2025-2026 Forester, 2026 Crosstrek, and 2019-2026 Ascent vehicles in retailer inventory affected by the WRH-26 Certification Label Non-Compliance Recall.

- The WRH-26 recall status for the affected vehicles in retailer inventory included in the stop sale are currently in an “Open-Limited Parts Available” status. All remaining affected vehicles are in an “Open-Remedy not yet available status”.
- Retailers should use the service procedure included at the end of this message to address recall completion for vehicles in an “Open-Limited Parts Available” status. **Coverage must be confirmed by using the Vehicle Coverage Inquiry function on subarunet.com prior to repair.** The recall bulletin will be posted on STIS early next week.
- We will be shipping the labels below directly to all Subaru retailers and could begin arriving to retailers as early as Saturday 7/18. You can view these orders in RPM and they will reference the WRH-26 recall. We will provide additional update regarding part shipments as they become available

| Models                          | Part Number | Label ID | Intended Usage                            |
|---------------------------------|-------------|----------|-------------------------------------------|
| 2026 Forester (hybrid, 18 inch) | 99095SL060  | A        | All affected stop sale and SSLP vehicles. |
| 2026 Forester (hybrid, 19 inch) | 99095SL070  | B        | All affected stop sale and SSLP vehicles. |
| Crosstrek Hybrid                | 99095FN000  | F        | Affected stop sale inventory only.        |


**NOTE:** We are very limited in the inventory that is being received and will be auto shipping parts as inventory arrives. Please do not submit orders for these part numbers. Any order placed will be cancelled. Similarly, please do not contact the PICs to request additional inventory.

### **SERVICE PROCEDURE INFORMATION**


**Step 1:** Locate the label on the bottom of the driver’s B-pillar.



**Step 2:** Moisten a small area of a clean cloth with isopropyl alcohol and clean the surface of the original label. **NEVER** attempt to peel off the original label as it includes the Vehicle Production Date and label damage will occur. Dry the label thoroughly.

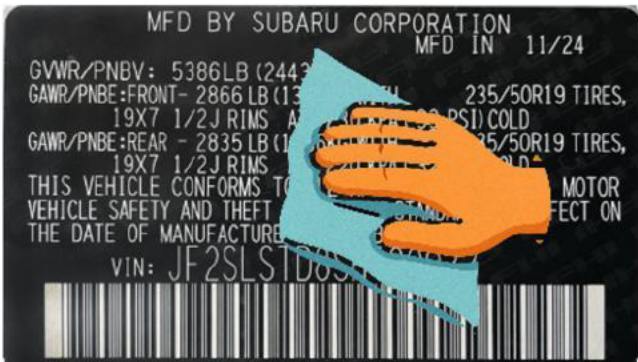


**Step 3:** Prepare the overlay label. Carefully peel the overlay label from its backing sheet, taking care not to damage the label.

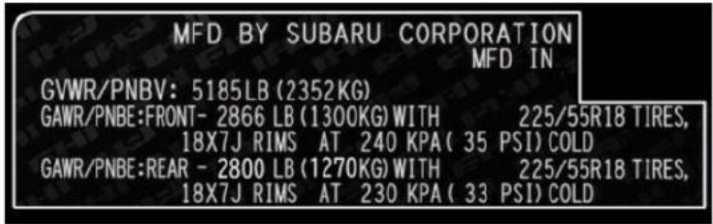

Peel the overlay label off its backing sheet.



**Step 4:** Align the overlay label with the position indicated by the dashed line, and slowly apply the label from one edge to the other to avoid trapping air.

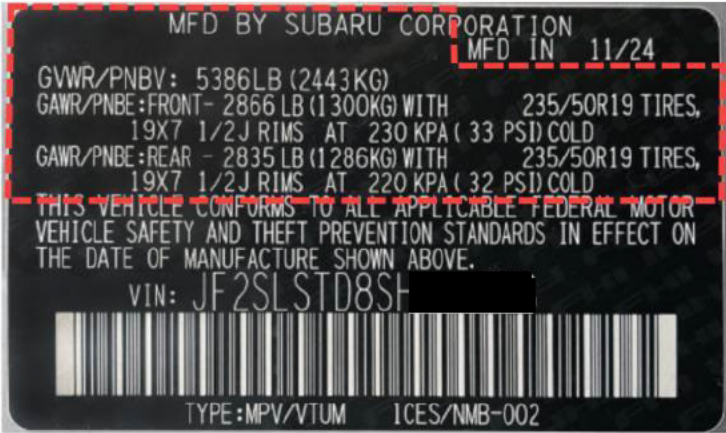

**Step 5:** Press firmly on the overlay label to ensure it adheres completely to the label.



### CLAIM REIMBURSEMENT AND ENTRY PROCEDURES:

Credit to perform this recall will be based on properly completed repair order information. Retailers may submit claims through [Subarunet.com](http://Subarunet.com).

| Warranty Type | Labor Description                          | Labor Operation # | Labor Time | Fail Code | Skill Level |
|---------------|--------------------------------------------|-------------------|------------|-----------|-------------|
| RC            | WRH-26 Tire Load Capacity Label<br>INSTALL | A100699           | 0.2h       | WRH26     | All         |

The Skill Group and Skill Level listed in this bulletin define the qualifications recommended for this work. Repairs should be dispatched to a technician who is trained at the specified level. For more information on Labor Operation Skill Group/Level assignments, [click here to access the Gear Reduction](#). To request a Skill Group/Skill Level change, [fill out this form](#).