

June 2026

IMPORTANT SAFETY RECALL 26506

NHTSA RECALL NO. 26V294

This notice applies to your vehicle identified on the enclosed card.

Dear International customer,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

International Motors, LLC* has decided that certain 2026 and 2027 International® HV™ Series trucks built 10/15/2025 thru 02/12/2026, with the following unique configurations (feature codes):

- 4 Channel ABS (0004AZA), Rear Axle 30/30 brake chamber (0004EXU), Walking Beam with Multi-leaf Spring Suspension 40K with 54" axle spacing (0014UHD) and Wheelbase of 640 or longer
- 4 Channel ABS (0004AZA), Rear Axle 30/30 brake chamber (0004EYL), Walking Beam with Multi-leaf Spring Suspension 46K with 54" axle spacing (0014UHD) and Wheelbase of 640 or longer
- 4 Channel ABS with Automatic Traction Control (0004AZI), Rear Axle 30/30 Brake Chamber (0004EXU), Walking Beam with Multi-leaf Spring Suspension 40K with 52" axle spacing (0014UHC) and Wheelbase of 520 or longer
- 4 Channel ABS with Automatic Traction Control (0004AZI), Rear Axle 30/30 Brake Chamber (0004EXU), Walking Beam with Multi-leaf Spring Suspension 40K with 54" axle spacing (0014UHD) and Wheelbase of 520 or longer
- 4 Channel ABS with Automatic Traction Control (0004AZI), Rear Axle 30/30 Brake Chamber (0004EXU), Walking Beam with Multi-leaf Spring Suspension 46K with 54" axle spacing (0014UHK) and Wheelbase of 520 or longer

fail to conform to Federal Motor Vehicle Safety Standard No. 121-Air Brake Systems

REASON FOR THIS RECALL

The suspect vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) No. 121 S5.3.4 brake release timing requirement. Each service brake system shall meet the requirements of S5.3.4.1 (a).

S5.3.4.1 (a) With an initial service brake chamber air pressure of 95 psi, the air pressure in each brake chamber shall, when measured from the first movement of the service brake control, fall to 5 psi in not more than 0.55 seconds

RISK TO MOTOR VEHICLE SAFETY

Vehicles not meeting the FMVSS No. 121 brake release timing requirement may have a delay in air pressure released from the brake chambers. Brakes that release too slowly could affect braking performance and increase the risk of a crash without prior warning.

REMEDY

The remedy will involve removing a 5/8-inch Air Line and installing it with a 3/4-inch Air Line and a quick-release valve. The repair will

be performed free of charge and take approximately 30 minutes to complete.

ACTIONS YOU SHOULD TAKE

If you own this vehicle, please schedule an appointment with any authorized repair center to have your vehicle repaired at no cost to you. You can find your nearest dealer by using the dealer locator at <https://www.internationaltrucks.com/dealer-locator> or by calling 1-800-448-7825 or find the nearest Love's center at <https://www.loves.com>. Love's and Speedco locations in Texas and Louisiana cannot perform warranty services.

If you have already paid for repairs prior to this notice that corrected this noncompliance, you may be eligible for reimbursement of certain repair expenses if they occurred 10/15/2025 thru 06/30/2026. Present your original repair paperwork and proof of payment to any International® dealer and your eligibility will be reviewed. You may also submit a claim using the enclosed Request for Reimbursement card.

If you are the lessor of this vehicle, please forward a copy of this notice to the lessee within ten days to comply with federal regulations.

If you do not own this vehicle, please fill out and return mail the enclosed card so that you will not be contacted again about this recall.

IF YOU NEED FURTHER ASSISTANCE

If you believe that International Motors, LLC has failed to remedy the noncompliance without charge or within a reasonable time, please follow the procedure described in the Owner Assistance Guide section in your Owner's Manual or call toll free 1-800-448-7825.

You may also submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave, SE, Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-888-275-9171); or go to <http://www.safercar.gov>.

International Motors, LLC requests your prompt attention and patience regarding the correction of this noncompliance and apologizes for any inconvenience this may cause you.