



VOLUNTARY RECALL CAMPAIGN

Classification: BT26-001	Reference: NTB26-005	Date: January 27, 2026
-----------------------------	-------------------------	---------------------------

VOLUNTARY SAFETY RECALL CAMPAIGN 2025-2026 ALTIMA, FRONTIER, KICKS, 2025 SENTRA; DOOR STRIKER REPLACEMENT

CAMPAIGN ID #: PD185 and PMA61
APPLIED VEHICLES: 2025-2026 Altima (L34)
2025-2026 Frontier (D41)
2025-2026 Kicks (P16)
2025 Sentra (B18)

**Check Service COMM or Dealer Business Systems (DBS)
National Service History to confirm campaign eligibility.**

INTRODUCTION

Nissan is conducting this voluntary safety recall campaign on certain specific model year 2025-2026 Altima, Frontier, Kicks, and 2025 Sentra vehicles to install new door strikers. This service will be performed at no charge to the customer for parts or labor.

IDENTIFICATION NUMBER


Nissan has assigned identification number PD185 and PMA61 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

REPAIR OVERVIEW

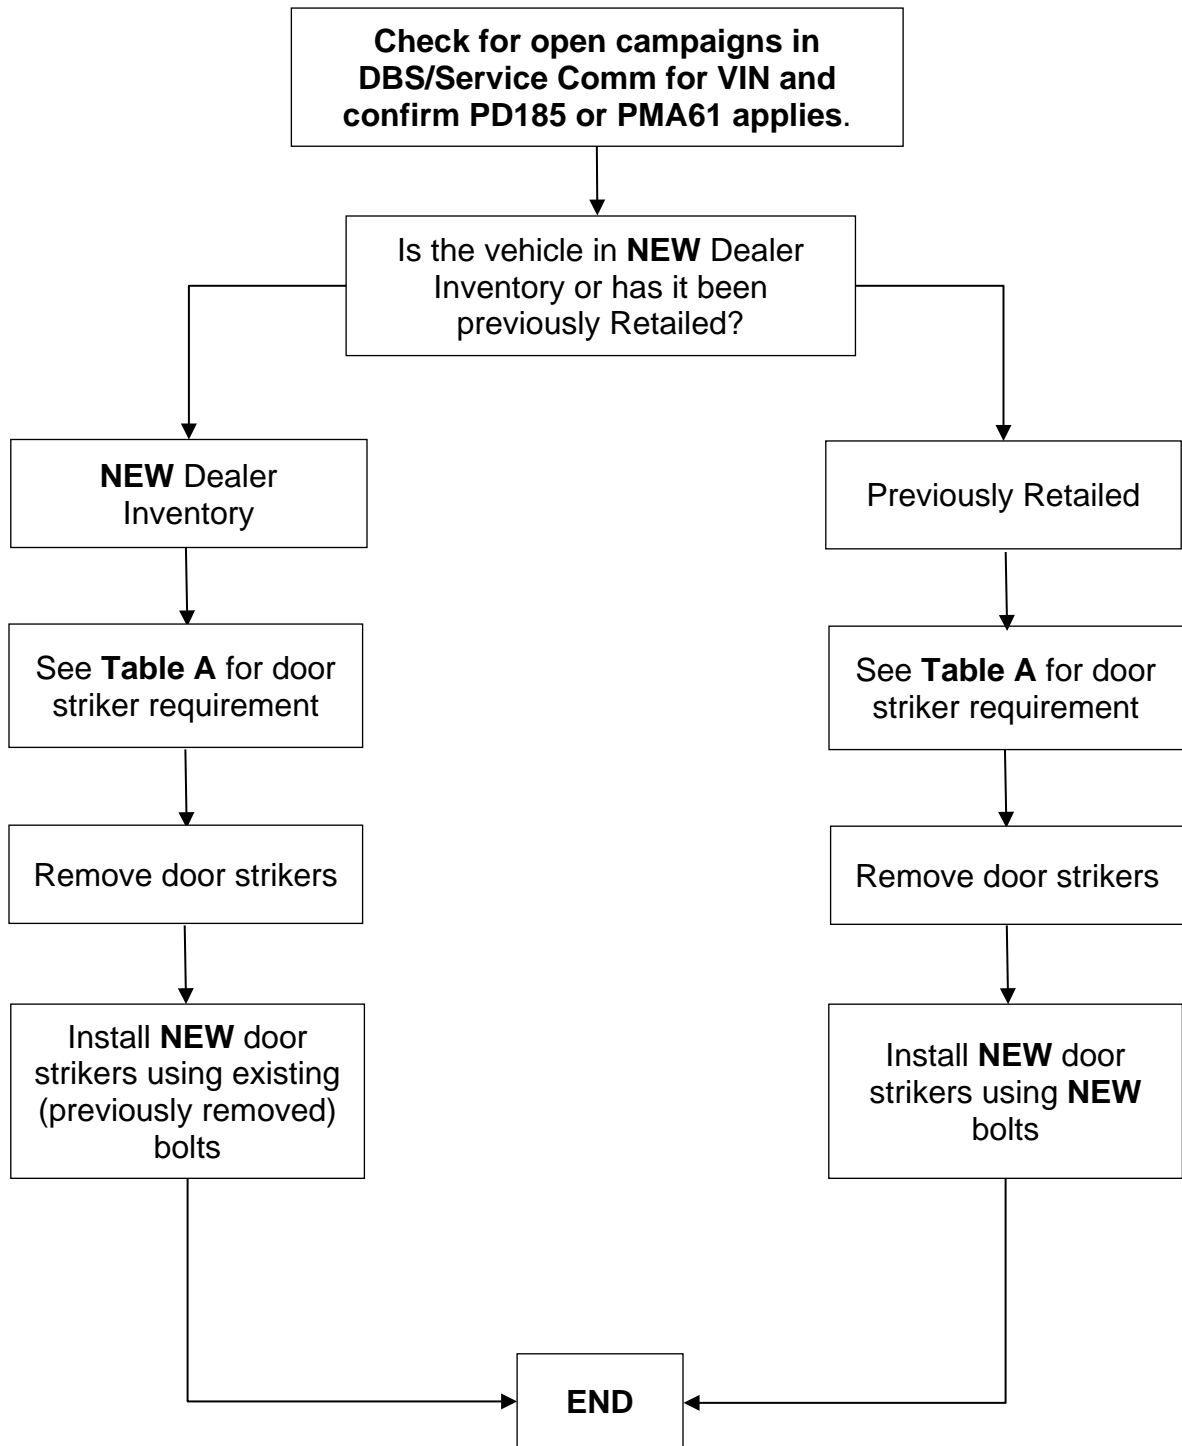

IMPORTANT: Using **Table A**, locate the correct model and identify which door strikers require replacement before beginning the **SERVICE PROCEDURE**.

Table A

Campaign (“CM”) ID	Model Years	Model	Replace
PD185	2025-2026	Frontier (King Cab)	Front Strikers Only
	2025-2026	Frontier (Crew Cab)	Front And Rear Strikers
	2025-2026	Altima	Front And Rear Strikers
PMA61	2025-2026	Kicks	Front And Rear Strikers
	2025	Sentra	Front And Rear Strikers

SERVICE PROCEDURE

1. Remove the required door strikers identified in **Table A**.
 - a. Mark the door strikers to be removed with an “**X**”.
 - b. Remove the retaining bolts from the door striker.
 - Striker bolts can only be reused for new dealer inventory vehicles. For retailed vehicles, **NEW** striker bolts must be used.
 - c. Remove the door striker and discard it.

2. Install the **NEW** door striker in the reverse order of removal.
 - a. Refer to the **REPAIR OVERVIEW** for door striker bolt requirements.
 - b. Door striker retaining bolt torque: 16.7 N•m (1.7 kg-m, **12 ft-lb**)
 - c. After installation, check door open/close operation. If necessary, adjust the door striker (steps 3 - 5 on page 4).

Door Striker Adjustment (If required)

3. Loosen the door striker retaining bolts.
4. Adjust the door striker so that it becomes parallel with the door lock insertion direction.
5. Tighten the door striker retaining bolts.
 - Door striker retaining bolt torque: 16.7 N•m (1.7 kg-m, **12 ft-lb**)

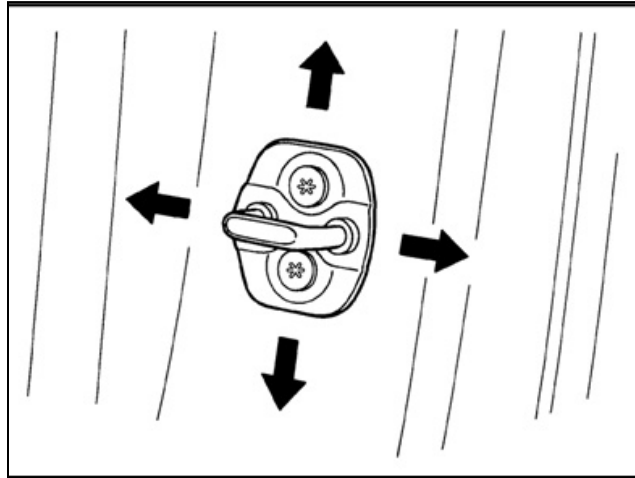


Figure 1

PARTS INFORMATION

Description	Models	Part Number	Quantity
DOOR STRIKER	All Models	80570-6CA0B	As Needed
BOLTS	Altima, Frontier	01432-0002X	As Needed
	Kicks, Sentra	80498-JK10A	As Needed

CLAIMS INFORMATION

Submit a "CM" line claim using the following claims coding:

CAMPAIGN ("CM") ID	DESCRIPTION	OP CODE	FRT
PD185	DEALER INVENTORY FRONTIER (KING CAB) REPLACE STRIKERS, REUSE BOLTS	PD1850	0.2
	DEALER INVENTORY FRONTIER (CREW CAB) / ALTIMA REPLACE STRIKERS, REUSE BOLTS	PD1851	0.3
	RETAILED VEHICLE FRONTIER (KING CAB) REPLACE STRIKERS AND BOLTS	PD1852	0.2
	RETAILED VEHICLE FRONTIER (CREW CAB) / ALTIMA REPLACE STRIKERS AND BOLTS	PD1853	0.3
PMA61	DEALER INVENTORY KICKS / SENTRA REPLACE STRIKERS, REUSE BOLTS	PMA610	0.3
	RETAILED VEHICLE KICKS / SENTRA REPLACE STRIKERS AND BOLTS	PMA611	0.3

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
January 27, 2026	NTB26-005	Original bulletin published