

Compliance Recall

Code: 57KS



Subject	Sunroof Control Module Software																			
Document History	<table border="1"> <thead> <tr> <th style="background-color: #c00000; color: white;">Date</th> <th colspan="4" style="background-color: #c00000; color: white;">Summary</th> </tr> </thead> <tbody> <tr> <td>04/14/2026</td> <td colspan="4">Updated claiming instructions to clarify that repair is now available for all affected vehicles.</td> </tr> <tr> <td>04/09/2026</td> <td colspan="4">Original publication</td> </tr> </tbody> </table>					Date	Summary				04/14/2026	Updated claiming instructions to clarify that repair is now available for all affected vehicles.				04/09/2026	Original publication			
Date	Summary																			
04/14/2026	Updated claiming instructions to clarify that repair is now available for all affected vehicles.																			
04/09/2026	Original publication																			
Affected Vehicles	<table border="1"> <thead> <tr> <th style="background-color: #c00000; color: white;">Country</th> <th style="background-color: #c00000; color: white;">Beginning Model Year</th> <th style="background-color: #c00000; color: white;">Ending Model Year</th> <th style="background-color: #c00000; color: white;">Vehicle</th> <th style="background-color: #c00000; color: white;">Vehicle Count</th> </tr> </thead> <tbody> <tr> <td>USA</td> <td>2026</td> <td>2026</td> <td>Q3</td> <td>6,077</td> </tr> <tr> <td>CAN</td> <td>2026</td> <td>2026</td> <td>Q3</td> <td>1,336</td> </tr> </tbody> </table> <p><i>Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.</i></p> <ul style="list-style-type: none"> ✓ Campaign status must show "open." ✓ If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign. 					Country	Beginning Model Year	Ending Model Year	Vehicle	Vehicle Count	USA	2026	2026	Q3	6,077	CAN	2026	2026	Q3	1,336
Country	Beginning Model Year	Ending Model Year	Vehicle	Vehicle Count																
USA	2026	2026	Q3	6,077																
CAN	2026	2026	Q3	1,336																
Problem Description	The target data container for the sunroof control unit was programmed incorrectly. As a result, the sunroof closing function may not comply with regulatory requirements. A sunroof closure operation that does not meet applicable regulatory requirements may create an increased risk of occupant injury.																			
Corrective Action	Install new target data container software in the sunroof control unit and provide an owner's manual supplement to describe the functionality of the sunroof with the corrected software.																			
Code Visibility	On April 08, 2026, the campaign code was applied to affected vehicles.																			
Owner Notification	Owner notification will take place in April 2026. Owner letter examples are included in this bulletin for your reference.																			
Additional Information	<p>Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.</p> <p>IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS</p> <p>USA Dealers - New Vehicles in Dealer Inventory: It is a violation of federal law for a dealer to deliver a new motor vehicle, or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.</p> <p>Canada Dealers – New Vehicles in Dealer Inventory: Dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Canadian Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.</p> <p>All Dealers - Pre-Owned Vehicles in Dealer Inventory: Dealers should not deliver any pre-owned vehicles in their inventory which are involved in a safety or compliance recall until the defect has been remedied.</p> <p>Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before delivery to consumers</u>.</p>																			

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2026 Audi of America, Inc. and Audi Canada. All Rights Reserved.

Claim Entry Instructions

The labor times listed here may differ from the labor operations and labor times listed in ELSA.

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action open on the day of repair to the repair order.

If a customer declines campaign work, refer to the “Customer Declines Campaign/Update Repair” section in the Campaign/Update Policy and Procedures Manual.

Service Number	57KS		
Damage Code	0099		
Parts Vendor Code	002		
Claim Type	Sold vehicle: 7 10 Unsold vehicle: 7 90		
Causal Indicator	Mark labor as causal		
Vehicle Wash/Loaner	Do not claim wash/loaner under this action		
Criteria I.D.	ALL DO NOT enter criteria 02 on the claim		
	Perform software update. Print and place owner’s manual supplement in glove compartment.		
	LABOR		
	Labor Op	Time Units	Description
	0151 00 10	SEE ELSA	Software update (<i>setup + battery charger</i>)
	0151 00 60	Time stated on diagnostic protocol (up to 50 TU)	Software update (<i>GFF Operations</i>)
	NOTE: Only the time on the diagnostic protocol should be claimed under labor operation 0151 00 60. Claims may be audited to ensure the time claimed matches the time stated on the diagnostic protocol related to this repair.		

Overview of criteria:

01 - Assigned to all VINs (perform software update)

02 - Assigned for administrative purposes only and is not associated with work needing to be performed. **DO NOT enter criteria 02 on the claim. Claims will stop if criteria 02 is entered.**

Customer Letter Example (USA)

This notice applies to your vehicle: <MODEL YEAR> <BRAND> <CARLINE>, <VIN>

NHTSA: 26V209

Subject: Compliance Recall 57KS - Sunroof Control Module Software

Dear Audi Owner,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Audi has decided that certain 2026 model year Audi vehicles fail to conform to with Federal Motor Vehicle Safety Standard (FMVSS) No. 118, *Power-Operated Window, Partition, and Roof Panel Systems*. Our records show that you are the owner of a vehicle affected by this action.

What is the issue?

Incorrect software may allow remote sunroof closing from a distance that prevents the operator from clearly seeing the sunroof. Closing the sunroof without the ability to see it can increase the risk of injury to occupants.

What will we do?

To correct this noncompliance, your authorized Audi dealer will install new target data container software in the sunroof control unit. In addition, an owner's manual supplement will be provided to describe the functionality of the sunroof with the corrected software. This work will take about an hour to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the work, as well as to accommodate their daily workshop schedule.

What should you do?

Please contact your authorized Audi dealer without delay to schedule this recall work. For your convenience, you can also visit www.audiusa.com and click on the "Find a Dealer" link to locate a dealer near you and schedule this service.

Additional Information

- If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt.
- If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, if you have changed your address or no longer own the vehicle identified in this letter, or if you should have any questions about this communication, please contact Audi Customer Experience at 1-800-253-2834 or via our "Contact Us" page at www.audiusa.com.
- If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY:1-888-275-9171); or go to <http://www.safercar.gov>.
- To check your vehicle's eligibility for repair under this or any other recall/service campaign, please visit the Recall/Service Campaign Lookup tool at www.audiusa.com and enter your Vehicle Identification Number (VIN).

We apologize for any inconvenience this matter may cause; however, we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Audi Customer Protection

Customer Letter Example (Canada)

This notice applies to your vehicle: <MODEL YEAR> <BRAND> <CARLINE>, <VIN>

Transport Canada Recall: 2026-157

Subject: Compliance Recall 57KS - Sunroof Control Module Software

Dear Audi Owner,

This notice is sent to you in accordance with the requirements of the *Motor Vehicle Safety Act*. This is to inform you that your vehicle may be non-compliant with the requirements of the *Motor Vehicle Safety Regulations* and that the non-compliance could affect the safety of a person. Our records show that you are the owner of a vehicle affected by this action.

What is the issue?

Incorrect software may allow remote sunroof closing from a distance that prevents the operator from clearly seeing the sunroof. As a result, the sunroof closing function may not comply with the regulatory requirements of Canada Motor Vehicle Safety Standard (CMVSS) No. 118, Power-Operated Window, Partition, and Roof Panel Systems. Closing the sunroof without the ability to see it can increase the risk of injury to occupants.

What will we do?

To correct this noncompliance, your authorized Audi dealer will install new target data container software in the sunroof control unit. In addition, an owner's manual supplement will be provided to describe the functionality of the sunroof with the corrected software. This work will take about an hour to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the work, as well as to accommodate their daily workshop schedule.

What should you do?

Please contact your authorized Audi dealer without delay to schedule this recall work.

Additional Information

- If you are the lessor and registered owner of the vehicle identified in this letter, you shall forward this letter (and any subsequent notice, if applicable) to the lessee within ten (10) days of receipt.
- If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, if you have changed your address or no longer own the vehicle identified in this letter, or if you should have any questions about this communication, please contact Audi Customer Relations Monday through Friday from 8AM to 8PM EST at 1-800-822-2834 or via our "Contact Audi Canada" page at www.audi.ca.

We apologize for any inconvenience this matter may cause; however, we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Audi Customer Protection

Required Tools



Battery Tester/Charger
-VAS5908-
(or equivalent charger with
a current rating of at least
90A)



Diagnostic Tester
-VAS6150D-
(or higher)

Repair Instruction

Section A - Check for Previous Repair

Applicable criteria ID(s)	Campaign/Action Status
01 ← 2	Open ← 1

EXAMPLE

Campaign/Action	Start	Designation
	2015-11-10	W-SERV_ACT -
	2018-12-13	RECALL -
	2017-05-16	A-RECALL -

EXAMPLE

- Enter the VIN in Elsa and proceed to the “Campaign/Action” screen.

TIP

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>. If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

CRITICAL REPAIR STEP



All campaigns/actions with a repair available must be performed in order of the Start date <arrow 3>. The oldest should be performed first (unless otherwise noted in the repair instructions).

Proceed to Section B

NOTE

- Damages resulting from improper repair or failure to follow these work instructions are the dealer’s responsibility and are not eligible for reimbursement under this action.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.

Section B – Sunroof Control Module Software Update

NOTE

Prior to launching the VAS Diagnostic Tester and starting an update, ensure the following conditions are met;

- ✓ **The ODIS software is completely up to date.**
 - Refer to the “Current ODIS Service Version” circular found in Elsa2Go Service References.
- ✓ **The battery charger is connected to the vehicle battery and remains connected for the duration of the software update.**
 - Battery voltage must remain above 12.5 volts **(or higher, if directed in the work instructions)** for the duration of the software update. Failure to do so may cause the update to fail, which could result in damage to the control module. Control modules damaged by insufficient voltage will not be covered.
- ✓ **The screen saver and power saving settings are off.**
 - Failure to do so may result in the tester entering power save mode during the software update, which could result in damage to the control module.
- ✓ **The VAS Diagnostic Tester is plugged in using the supplied power adapters.**
 - Under no circumstances should the tester be used on battery power alone during the software update. Failure to do so may result in the tester powering off during the update, which could result in damage to the control module.
- ✓ **Flash process through “Audi Flashing” not Guided Fault Finding (GFF).**
 - DO NOT USE Guided Fault Finding (GFF) to perform this flash. Using GFF will cause the flash to take longer. Requests for additional time will not be considered.
- ✓ **The VAS Diagnostics Interface MUST ONLY be connected to the tester with a USB cable.**
 - Performing a software update using a Bluetooth or Wi-Fi connection increases the risk of losing connection during the update, which could result in damage to the control module. It also greatly increases the time required to perform the update. Requests for additional time or parts will be denied if the GFF log shows the update was performed using Bluetooth or WiFi.

NOTE

- All campaign software updates must be completed during a single, standalone ODIS Diagnostic Session. You must fully complete this campaign and send all logs before beginning any other campaigns or operations.
- If there are any ODIS “Hot-Fix” patches installed, they must be removed from the scan tool before beginning this operation. ODIS “Hot-Fix” patches may affect the update process.

WARNING


Radiator Fan(s) may cycle ON high speed during the Update Process! There is a serious risk that personal injury may result if contact is made with spinning fan blades. Keep hands and all objects away from Radiator Fan(s) during Update Process!

IMPORTANT

To Update-Programming using SVM, review and follow instructions in Technical Bulletin 2011732: *Software Version Management (SVM) Operating Instructions* for the US, or 2037026: *Working with the Software Version Management (SVM)* for Canada.

The SVM Process must be completed in its entirety so the database receives the update confirmation response. A warranty claim may not be reimbursed if there is no confirmation response to support the claim.

- Switch off all consumers, air conditioning, heater blower motor, lights, heated seats, etc.
- Connect battery charger.
- Ensure the latest version of ODIS is downloaded.
- Ensure diagnostic head is connected to ODIS tester via USB cable.
- Move selector lever to P.
- Place the key in the cupholder over the reader coil icon.
- **Close the sunshade and sunroof before starting the flash.**
- Use operating mode, FLASH.
 - Communication path = DoIP (automatically determined by ODIS)
- Select "SVM – Code Input".
- Enter SVM code **BLQ3PSDZDC** and follow the on-screen prompts.
- Ensure the diagnostic log is sent to GFF Paperless after completion.

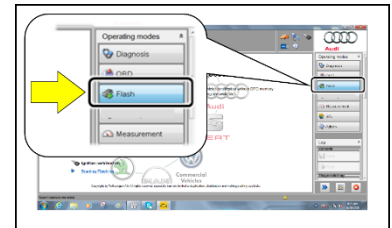


Proceed to Section C

IMPORTANT

If the software update fails for any reason, ODIS feedback must be sent prior to further diagnosis. This ensures the failure/error is reported. Failure to do so may result in non-payment of consequential requests for additional time or parts.

Section C – Print Out Owner’s Manual Supplement

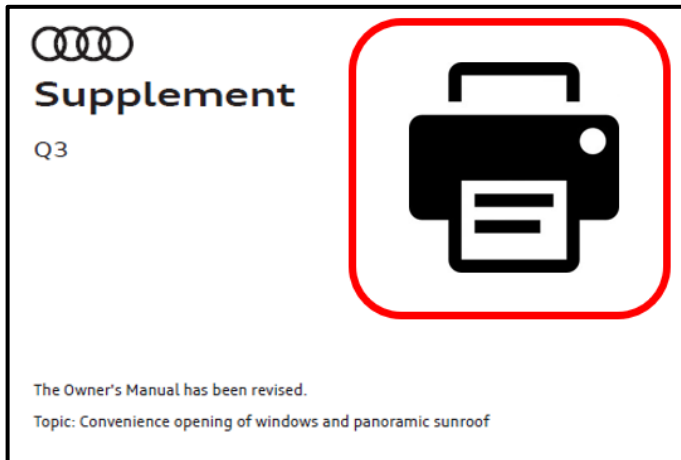

- U.S.A.: Print out the English owner's manual supplement found on one of the ELSA attachment tabs.
- CANADA: Print out both the English and French owner's manual supplements found on one of the ELSA attachment tabs.
- The supplements are also available in Service References in Elsa2Go.
- Fold and place the printed owner's manual supplement in the vehicle glove compartment.

Proceed to Section D

Section D – Campaign Stamp

I certify that this campaign
has been performed in strict
accordance with the applicable
Audi repair procedure.

SAGA Code: _____

Technician: _____

Date: _____

Item#: AUD4927ENG

OR

Je certifie que cette
campagne de rappel a été
exécutée suivant les strictes
directives de réparation
d'Audi

Code de SAGA: _____

Technicien: _____

Date: _____

Item # AUD4927FRE

- Once the campaign has been completed, the technician should stamp the repair order.
- Stamps are available for ordering through the Compliance Label Ordering Portal (item# AUD4927ENG or AUD4927FRE).