

WINNEBAGO®		Generator Unintended Self-Start			
Classification		Parts Kit Required			
Recall # 205		Part #	NA	Description	NA
Condition					
Certain Winnebago vehicles equipped with Precision Circuits touchscreen displays running firmware version 101.000067 or earlier, contain a software defect that may cause the generator to start without operator input.					
Correction					
Complete a Firmware update 101.000069 to the Precisions Circuits display touch screen.					
WGO Model Year	Revision	Make	Model	Model Code(s) (Floorplan)	WGO Built/Manufacturing Dates Impacted
2022	1	Winnebago	Ekko	WF622A	1/14/2021 – 4/16/2026
2023	2				
2024	1				
2025	1				
2026	1				
2027	1				
Disclaimer: Read the entire instructions carefully before starting the procedure. If you have any questions, please contact the Winnebago Industries Technical Service Department by calling 1-866-653-4329 or by email: techservice@wgo.net . This document is confidential and is intended for dealer use only.					

Parts/Kit Image Reference


Parts Required –

1. PCI Updater –(Phone app from either Apple's App Store or Google's Play Store)

Shop Supplies

1. Phone or Tablet

App Required

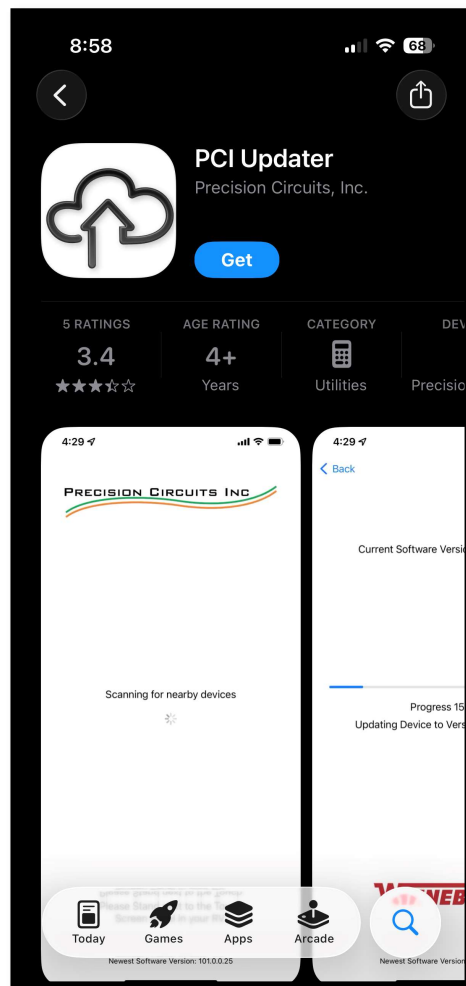

PCI Contact if Needed:

2538 Wisconsin Ave Downers Grove, IL 60515

www.PrecisionCircuitsInc.com

630-515-9100

1.

Steps & Procedures

Step 1 – Download the PCI Updater App

a. Download the Precision Circuits, Inc.

"PCI Updater" app from the Apple App Store or Google Play Store on your **phone** or tablet.

Step 2 – Update the Firmware

a. Power on the Digi-Level touchscreen.

b. Open the app. It will automatically scan for your Digi-Level system.

c. Once the application finds your RV, it will automatically update the touchscreen to the latest version (**101_00_69** or **101.000069**). You will see a progress bar on both your app and on the touch screen. Please wait as this could take over a minute. If a freeze warning appears, clear the error if you want to see the progress.


d. You may see a second progress bar on the touchscreen after it has been updated. This is normal and indicates it found another component in the system that also needed an update.

e. When the Digi-Level system is updated and restarts itself, there are a couple of things to note.

1) It may take a couple of minutes for the tank communications to be re-established.

2) The water pump may see a signal and turn itself on.

f. To avoid these issues, wait until the update has finished. Turn your system off for two minutes and then turn it back on again.

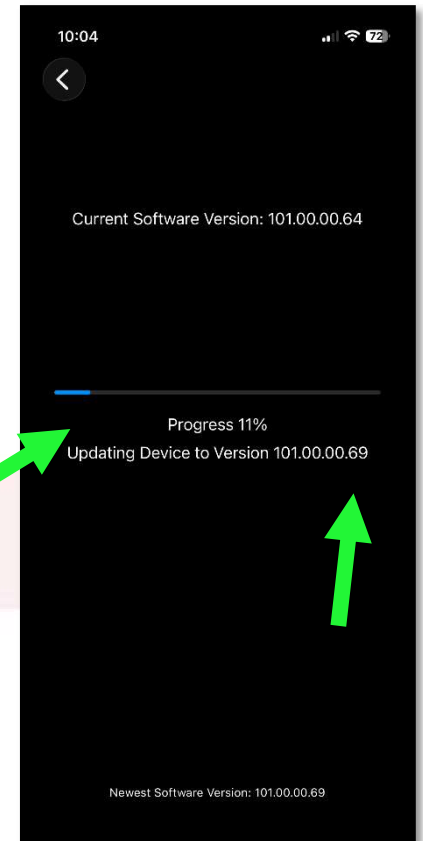

Step 3 – Confirm Firmware Updated Successfully

a. To ensure a successful update, verify that your current firmware version is at **101.000069**.

You can check this on the PCI touchscreen by navigating to the Settings Screen; the version number can be found in the lower-left corner.

