

Recall Campaign Bulletin



June 2026

TO: ALL MERCEDES-BENZ DEALERS

CAMPAIGN NO.	2026060004
CAMPAIGN DESC.	26P9190322
NHTSA ID	26V353
SUBJECT	Bolting Connection of the Rear Seat Belt
MODEL(S)	GLE and GLS (167 platform)
MODEL YEAR(S)	2026
CAMPAIGN POPULATION	203

Campaign Technical Instructions

Prior to performing this Campaign:

Check the Vehicle Master Inquiry (VMI) to verify this campaign applies to the specific vehicle.

1. Always check for other open campaigns and perform them accordingly!
2. Review the entire campaign bulletin first, and perform the procedures exactly as described.

Order No. P-RC-2026060004

Recall Campaign Bulletin

Work Procedure

1. Tighten screws for seat belt bracket (Illustration 1) of both outer seat belts in rear passenger compartment to a **tightening torque of 35 Nm**.

i Model 167.1 except code 567, see AR91.12-P-1021ME

Remove seat cushion in rear passenger compartment and tighten screws for seat belt bracket of outer rear seat belts.

i Model 167.1 with code 567

Fold rear seat backrest forward, move rear seats all the way to the front, and tighten screws for seat belt bracket of outer rear seat belts.

i Model 167.3, see AR91.12-P-1021ME

Remove seat cushion in rear passenger compartment and tighten screws for seat belt bracket of outer rear seat belts.

i Model 167.9 with code M036 (Maybach version), see AR91.12-P-1021MEM

Remove seat cushion in rear passenger compartment and tighten screws for seat belt bracket of outer rear seat belts.

i Model 167.9 except code M036 (Maybach version):

Fold rear seat backrest forward, move rear seats all the way to the front, and tighten screws for seat belt bracket of outer rear seat belts.

Illustration 1 (Example of seat belt bracket)



Model(s): 167

Warranty Information

 **Note:** The following allowable labor operation should be used when submitting a warranty claim for this repair:

Damage Code	Operation Number	Description	Labor Time (hrs.)
91 903 22	11-0135	Tighten screws for seat belt bracket for outer rear seat belts Model 167.1 EXCEPT code 567 Includes: Remove rear seat cushion	0.3
		Tighten screws for seat belt bracket for outer rear seat belts Model 167.1 WITH code 567 Includes: Fold rear seat backrest forward, move rear seats all the way to the front	0.2
		Tighten screws for seat belt bracket for outer rear seat belts Model 167.3 Includes: Remove rear seat cushion	0.3
		Tighten screws for seat belt bracket for outer rear seat belts Model 167.9 EXCEPT code M036 Includes: Fold rear seat backrest forward, move rear seats all the way to the front	0.2
		Tighten screws for seat belt bracket for outer rear seat belts Model 167.987 WITH code M036 Includes: Remove rear seat cushion	0.5

 **Note:** Always check Xentry Operation Time (XOT) for the current OP-Code times. Labor times are subject to change and updates may not be reflected in this document.

 Small parts such as screws, lock nuts, sealing rings, cable ties, fluids, sealant, etc. are not listed in the parts list, but may be claimed as needed. The required small parts are taken into account in the budgeting.