



# VOLUNTARY RECALL CAMPAIGN

|                 |            |               |
|-----------------|------------|---------------|
| Classification: | Reference: | Date:         |
| FA26-003        | NTB26-039  | June 29, 2026 |

## VOLUNTARY SAFETY RECALL CAMPAIGN 2025 SENTRA; FRONT LH DRIVE SHAFT

**CAMPAIGN ID #:** PMA68  
**APPLIED VEHICLES:** 2025 Sentra (B18)

**Check Service COMM or Dealer Business Systems (DBS)  
National Service History to confirm campaign eligibility.**

### INTRODUCTION

Nissan is conducting this voluntary safety recall campaign on certain specific model year 2025 Sentra vehicles to inspect and, if necessary, replace the Front LH Drive Shaft and the CVT. This service will be performed at no charge to the customer for parts or labor.

### IDENTIFICATION NUMBER


Nissan has assigned identification number PMA68 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

### DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## REPAIR OVERVIEW

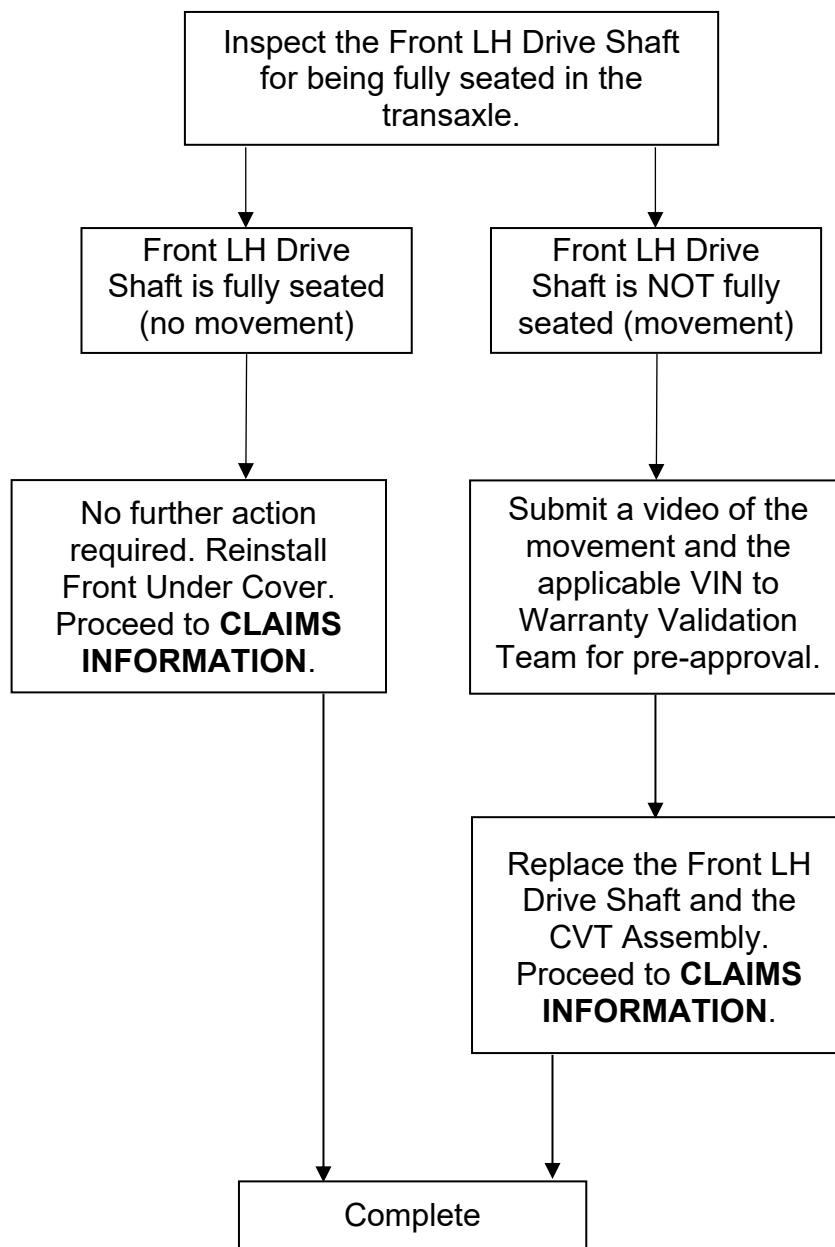

## SERVICE PROCEDURE

### Inspection

1. Raise and suitably support the vehicle.

2. Remove the Front Under Cover.

- Refer to the ESM: **BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > EXTERIOR > REMOVAL AND INSTALLATION > UNDER COVER > FRONT UNDER COVER > Removal and Installation**

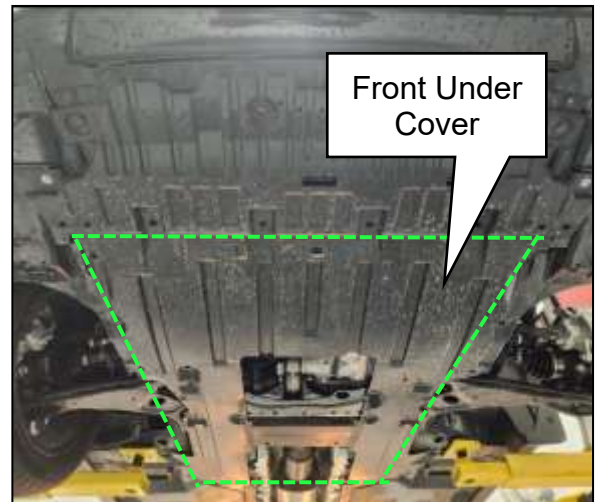


Figure 1

3. Locate the Front LH (driver side) Drive Shaft Inner Joint.

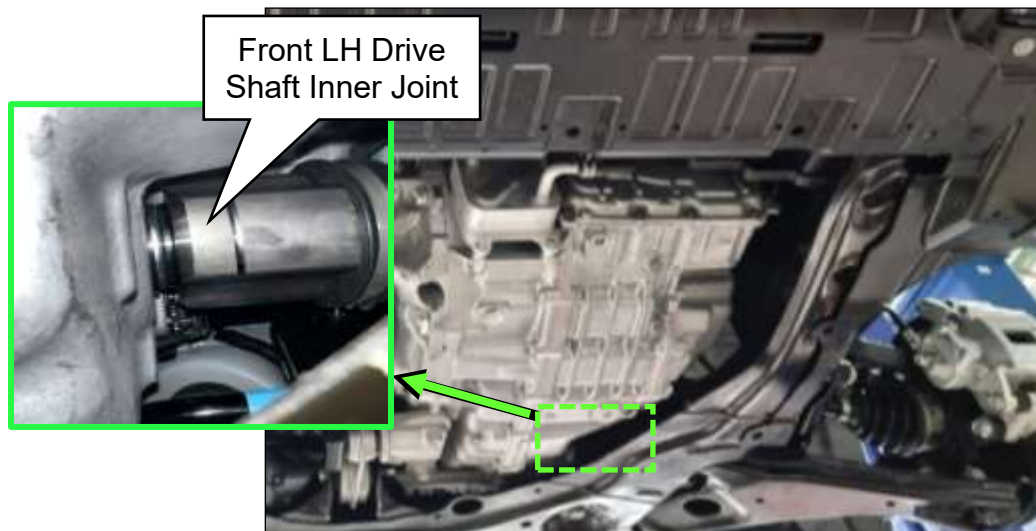


Figure 2

4. Verify the Front LH Drive Shaft is fully seated in the transaxle.

**HINT:** When the Front LH Drive Shaft is NOT fully seated in the transaxle, the Drive Shaft will move outward easily with little to no pry force.

- a. Place a long flat-blade screwdriver between the Front LH Drive Shaft and the transaxle case, as shown in Figure 3.
- b. Using light force, gently pry the Front LH Drive Shaft outward (away from the transaxle case) while watching the Front LH Drive Shaft Inner Joint for movement.

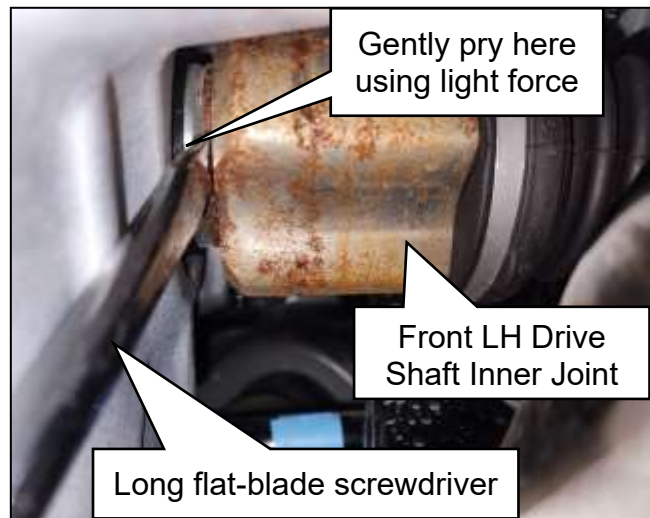


Figure 3

5. Did the Front LH Drive Shaft Inner Joint move outward when gently prying away from the transaxle case?

- Document the results on the repair order.

**NO:** Drive Shaft did NOT move, Good Result: No further action is necessary. Reinstall the Front Under Cover and proceed to **CLAIMS INFORMATION** on the last page.

**YES:** Drive Shaft moved, No Good Result: Continue to step 6.



Figure 4



Figure 5

6. Submit a video with the movement and the applicable VIN to Warranty Validation Team for pre-approval, then continue to step 7 on page 5 to replace the Front LH Drive Shaft and the CVT.

## Front LH Drive Shaft Removal

New or replacement Essential Tools are available from Tech Mate online: [www.techmatetools.com](http://www.techmatetools.com), or by phone: 1-833-397-3493.

When ordering, keep in mind that the tool part number prefix has changed from “J” to “NI”. For example, J-52982 is now **NI-52982**.

### Required Special Tool - Lock Nut Chisel [Cape Chisel (NI-52982)]

- Cape Chisel (J-52982).

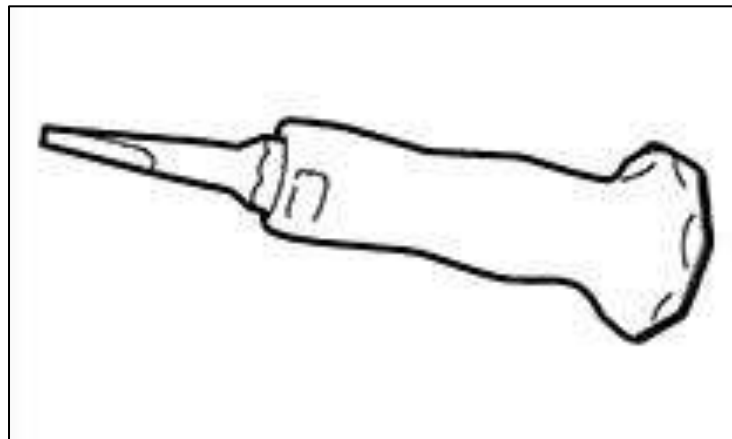


Figure 6

7. Remove the Front LH Drive Shaft and discard it.
  - Refer to the ESM: **TRANSMISSION & DRIVELINE > FRONT AXLE > REMOVAL AND INSTALLATION > FRONT DRIVE SHAFT > Removal and Installation (LH)**

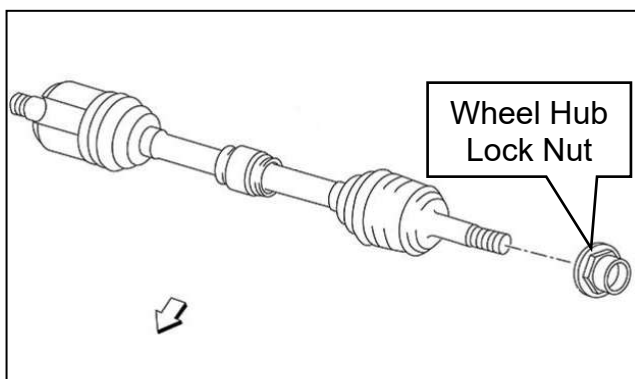


Figure 7

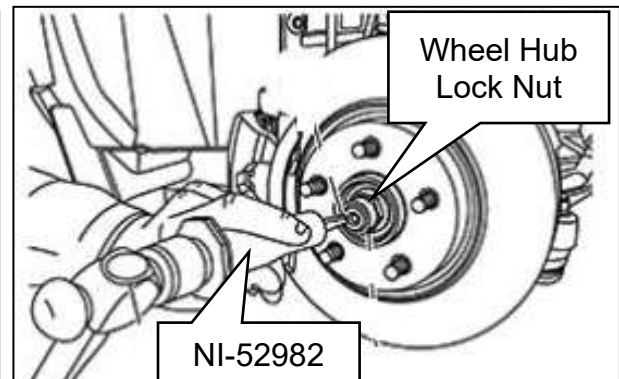


Figure 8

## CVT Removal

### **WARNING**

To avoid the risk of death or severe personal injury, do not remove the radiator cap when the engine is hot. Serious burns could occur from high pressure coolant escaping from the radiator. Perform repairs when the engine is cold. Wrap a thick cloth around the cap. Slowly turn a quarter turn to allow built-up pressure to escape. Carefully remove the cap by turning it all the way.

### **CAUTION**

To help reduce risk of moderate personal injury and/or property damage due to improper vehicle operation following repair:

- Perform **ADDITIONAL SERVICE WHEN REPLACING TRANSAXLE ASSEMBLY** when replacing the transaxle assembly.
- Perform **ADDITIONAL SERVICE WHEN REPLACING TCM AND TRANSAXLE ASSEMBLY** when replacing the TCM and the transaxle assembly simultaneously.

### **NOTICE**

When removing components such as hoses, tubes/lines, etc., cap or plug openings to prevent fluid from spilling and/or damage to the vehicle.

**IMPORTANT:** The CVT assembly should **ONLY** be replaced if the Front LH Drive Shaft had movement when inspected in step 4 and step 5 on page 4.

8. Remove the CVT assembly.

- Refer to the ESM: **TRANSMISSION & DRIVELINE > TRANSAXLE & TRANSMISSION > CVT: RE0F15A > UNIT REMOVAL AND INSTALLATION > TRANSAXLE ASSEMBLY > Removal and Installation**



## CVT Installation

### **CAUTION**

To avoid the risk of moderate personal injury and/or damage to the vehicle:

- When replacing the transaxle, you must make sure any dowels are installed correctly during reassembly.
  - Improper alignment caused by missing dowels may cause vibration, oil leaks, or breakage of drivetrain components.
- Do not reuse O-rings or copper sealing washers to prevent leaks.
- When turning crankshaft, turn it clockwise as viewed from facing the crankshaft pulley bolt.
- When tightening the nuts for the torque converter while securing the crankshaft pulley bolt, be sure to confirm the tightening torque of the crankshaft pulley bolt.
- After the torque converter is installed to the drive plate, rotate the crankshaft several turns to check that the CVT rotates freely without binding.
- When installing the drive plate to torque converter nuts, tighten them temporarily. Then tighten the nuts to the specified torque.

9. Write down the serial number of the new transaxle assembly.

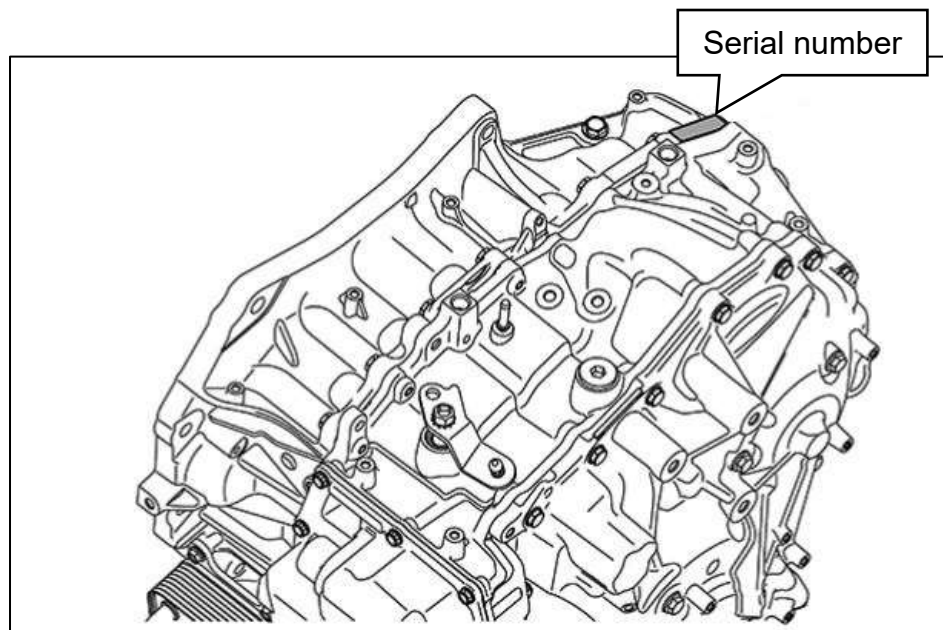


Figure 9

10. Install the CVT assembly.

- Refer to the ESM: **TRANSMISSION & DRIVELINE > TRANSAXLE & TRANSMISSION > CVT: RE0F15A > UNIT REMOVAL AND INSTALLATION > TRANSAXLE ASSEMBLY > Removal and Installation**
  - Tighten the transaxle assembly to engine assembly mounting bolts to 62.0 N•m (6.3 kg-m, **46 ft-lb**).
  - Tighten the torque converter nuts to 51.0 N•m (5.2 kg-m, **38 ft-lb**).

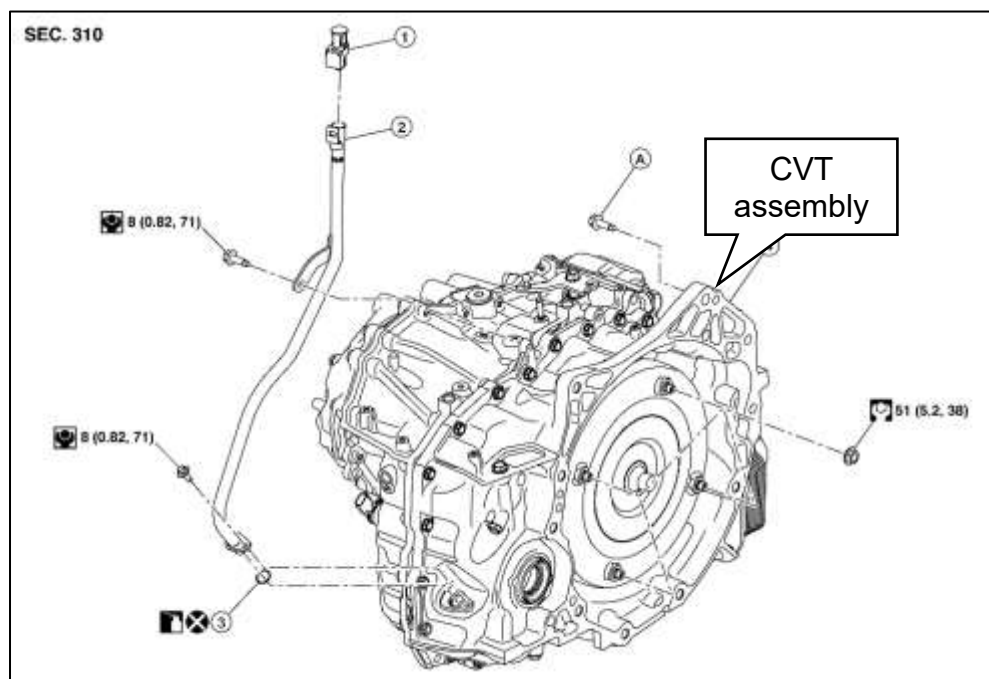


Figure 10

**HINT:** Do not lubricate engine assembly mounting bolts.

| Bolt symbol                            | (A)                         | (B)                         | (C)                  |
|----------------------------------------|-----------------------------|-----------------------------|----------------------|
| Insertion direction                    | Transaxle to cylinder block | Cylinder block to transaxle | Oil pan to transaxle |
| Quantity                               | 1                           | 3                           | 4                    |
| Bolt length<br>" & # x" mm (in)        | 55 (2.17)                   | 50.5 (1.988)                | 50.5 (1.988)         |
| Tightening torque<br>N-m (kg-m, ft-lb) | 62.0 (6.3, 46)              |                             |                      |

TGAJDIA1342ZZ

Figure 11



## Front LH Drive Shaft Replacement

11. Replace the Front LH Drive Shaft (Figure 12).

- Refer to the ESM: **TRANSMISSION & DRIVELINE > FRONT AXLE > REMOVAL AND INSTALLATION > FRONT DRIVE SHAFT > Removal and Installation (LH)**

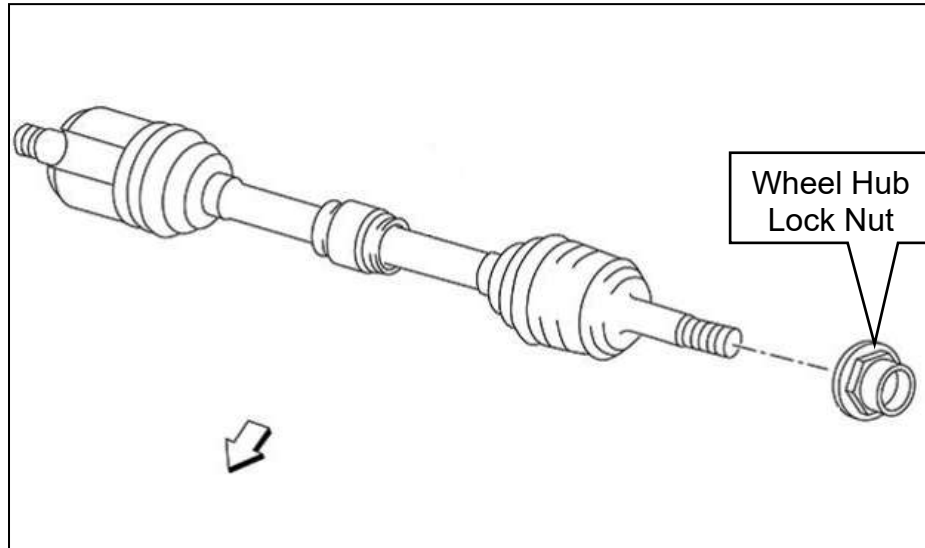


Figure 12

- Tighten the NEW lower ball joint nut to 75.0 N•m (7.7 kg-m, **55 ft-lb**).
- Tighten the NEW outer socket nut to 34.4 N•m (3.5 kg-m, **25 ft-lb**).
- Tighten the NEW stabilizer bar link nuts to 62.0 N•m (6.3 kg-m, **46 ft-lb**).
- Tighten the CVT fluid charging pipe retaining bolts to 8.0 N•m (0.82 kg-m, **71 in-lb**).
- Tighten the NEW Front LH Wheel Hub Lock Nut to 165.0 N•m (17.0 kg-m, **122 ft-lb**).
- Tighten wheel and tire assemblies to 113.0 N•m (12.0 kg-m, **83 ft-lb**).

### **⚠ WARNING**

To avoid the risk of death or severe personal injury, do not reuse the wheel hub lock nut.

### **⚠ CAUTION**

To avoid the risk of moderate personal injury or property damage to the vehicle:

- Ensure the circular clip is properly engaged into the transaxle, grasp the Drive Shaft housing and pull back and forth in axial direction while listening for clicking sounds.
- Use a torque wrench and not a power tool to tighten the wheel hub lock nut since the Drive Shaft is assembled by press fitting.
  - Tighten the wheel hub lock nut to specification as too much torque causes axle noise and too little torque causes wheel bearing looseness.

12. Fill and adjust the CVT fluid level as necessary.
  - Refer to the ESM: **TRANSMISSION & DRIVELINE > TRANSAXLE & TRANSMISSION – CVT: RE0F15A > PERIODIC MAINTENANCE > CVT FLUID > Adjustment**
13. Reinstall the Front Under Cover.
  - Refer to the ESM: **BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > EXTERIOR > REMOVAL AND INSTALLATION > UNDER COVER > FRONT UNDER COVER > Removal and Installation**
14. After replacing the transaxle assembly, perform **ADDITIONAL SERVICE WHEN REPLACING TRANSAXLE ASSEMBLY**.
  - Refer to the ESM: **TRANSMISSION & DRIVELINE > TRANSAXLE & TRANSMISSION > CVT: RE0F15A > BASIC INSPECTION > ADDITIONAL SERVICE WHEN REPLACING TRANSAXLE ASSEMBLY - Description**
15. Perform a front wheel alignment.
  - Refer to the ESM: **SUSPENSION > FRONT SUSPENSION > PERIODIC MAINTENANCE > WHEEL ALIGNMENT > Adjustment**
16. On all models, perform Radar Alignment.
  - Refer to the ESM: **CRUISE CONTROL & DRIVER ASSISTANCE > DRIVER ASSISTANCE SYSTEM > DRIVER ASSISTANCE SYSTEM > BASIC INSPECTION > DISTANCE SENSOR ALIGNMENT > Work Procedure**
17. On SV and SR models with Premium Package (With AVM), perform Front Camera Calibration.
  - Refer to the ESM: **DRIVER INFORMATION & MULTIMEDIA > AUDIO, VISUAL & NAVIGATION SYSTEM > INTELLIGENT AROUND VIEW MONITOR SYSTEM > BASIC INSPECTION > CALIBRATING CAMERA IMAGE (INTELLIGENT AROUND VIEW MONITOR) > Work Procedure**
18. On all models, perform AEB System Action Test.
  - Refer to the ESM: **BRAKES > BRAKE CONTROL SYSTEM > AUTOMATIC EMERGENCY BRAKING > BASIC INSPECTION > ACTION TEST > Work Procedure**

## PARTS INFORMATION

| DESCRIPTION                           | PART NUMBER    | QUANTITY               |
|---------------------------------------|----------------|------------------------|
| AUTOMATIC TRANSAXLE (1)               | 31020-X260A    | 1                      |
| AUTOMATIC TRANSAXLE ASSY – REMAN (2)  | 3102M-X260A-RE | 1                      |
| SHAFT ASSY – FRONT DRIVE, LH          | 39101-6LY0A    | 1                      |
| SEAL – O-RING (Oil Fill Tube)         | 31084-M750A    | 1                      |
| GASKET – EXHAUST                      | 20692-1HA0A    | 1                      |
| GASKET – EXHAUST                      | 20691-30P0A    | 1                      |
| BLUE LONG LIFE COOLANT / 1 GL (3)     | 999MPL25500P   | 1 Gal                  |
| AT COOLER FLUSH 15 OZ (3)             | 999MPAM006P    | 1                      |
| OIL ATF CVT_12 (NS3 CVT FLUID) (3)    | 999MP-CV0NS3   | 1 case of<br>12 quarts |
| GASKET – EGR GUIDE TUBE               | 14722-5RF0A    | 1                      |
| EGR VALVE GASKET                      | 14719-5TA0A    | 2                      |
| SEAL – O-RING (Fill Plug)             | 31526-3VX0B    | 1                      |
| SEAL – O-RING (Drain)                 | 31526-1XA01    | 1                      |
| CLAMP (CVT Oil Warmer)                | 16439-7S01E    | 2                      |
| CIRCLIP – SIDE GEAR                   | 38225-ET01C    | 2<br>As needed         |
| NUT – LOCK, FRONT WHEEL BEARING       | 40262-4GA0D    | 2                      |
| NUT (Lower Ball Joint)                | 01223-A0111    | 2                      |
| NUT                                   | 54588-JA060    | 2                      |
| NUT                                   | 01225-A0111    | 4                      |
| NUT – FIX, EXHAUST TUBE               | 20602-9U20B    | 2                      |
| RETAINER – BEARING, FRONT DRIVE SHAFT | 39776-EN000    | 1                      |

(1) Unsold vehicles only.

(2) All EXCEPT unsold vehicles.

(3) Order this item through the Nissan Maintenance Advantage program: Phone 877-NIS-NMA1 (877-647-6621). Website order via link on the dealer portal; [www.NNAnet.com](http://www.NNAnet.com) and click on the “Maintenance Advantage-Tire/Battery/Chemical” link.

## CLAIMS INFORMATION

Submit a "CM" line claim using the following claims coding:

| CAMPAIGN<br>("CM") ID | DESCRIPTION                                                                                                                   | OP CODE       |                | FRT  |
|-----------------------|-------------------------------------------------------------------------------------------------------------------------------|---------------|----------------|------|
| PMA68                 | Inspect Front LH Drive Shaft For Movement - OK                                                                                | PMA680        |                | 0.4  |
|                       | Inspect Front LH Drive Shaft For Movement, Replace CVT Assembly And Front LH Drive Shaft, And Fill and Adjust CVT Fluid Level | PMA681<br>(1) | Without<br>AVM | 10.0 |
|                       |                                                                                                                               | PMA682<br>(1) | With AVM       | 10.4 |

(1) Warranty Validation Team approval required. Failure to obtain pre-approval prior to replacement may result in chargeback.

## AMENDMENT HISTORY

| PUBLISHED DATE | REFERENCE | DESCRIPTION                 |
|----------------|-----------|-----------------------------|
| June 29, 2026  | NTB26-039 | Original bulletin published |

