



VOLUNTARY RECALL CAMPAIGN

Classification:	Reference:	Date:
BT26-009A	ITB26-008A	August 11, 2026

VOLUNTARY RECALL CAMPAIGN 2020-2026 QX80; CERTIFICATION LABEL

This bulletin has been amended. See AMENDMENT HISTORY on the last page.
Please discard previous versions of this bulletin.

CAMPAIGN ID #: P6A14
APPLIED VEHICLES: 2020-2024 QX80 (Z62)
2025-2026 QX80 (Z63)

**Check Service COMM or Dealer Business Systems (DBS)
National Service History to confirm campaign eligibility.**

HINT: Vehicles affected by this campaign will have a new label supplied to the retailer for vehicles in retailer inventory.

INTRODUCTION

The Certification Label on certain specific Model Year 2020-2026 Infiniti QX80 vehicles does not contain the correct Gross Axle Weight Rating (GAWR) information as required by the applicable regulation. To remedy this issue, Infiniti is providing retailers with a replacement Certification Label. The replacement label will be affixed by the Infiniti retailer.

IDENTIFICATION NUMBER

Infiniti has assigned identification number P6A14 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

RETAILER RESPONSIBILITY

It is the retailer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary non-compliance recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a retailer's inventory. **Federal law requires that new vehicles in retailer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Infiniti strongly encourages retailers to correct any used vehicles in their inventory before they are retailed.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.

SERVICE PROCEDURE

IMPORTANT:

- All Retailer inventory vehicles affected by this campaign will have a NEW Certification Label supplied to the retailer.
 - Each replacement certification label is vehicle specific. Make sure the VIN on the new certification label matches the VIN on the vehicle/old certification label.
 - The replacement certification label is a different color (Gray) and will be installed over the existing black label. The edges of the black label may be visible.
 - **DO NOT REMOVE THE EXISTING LABEL.** Affix the replacement label over the existing label.
1. Park the vehicle in a safe place with the automatic transmission in Park, the ignition OFF, and the parking brake ON/applied.
 2. Open the driver's door.
 3. Locate the existing certification label (Figure 1).
HINT: The certification label has the VIN on it.
 4. Make sure the VIN on the new certification label matches the VIN on the old certification label (Figure 2 and Figure 3).
 - The VINs MUST MATCH.



Figure 1

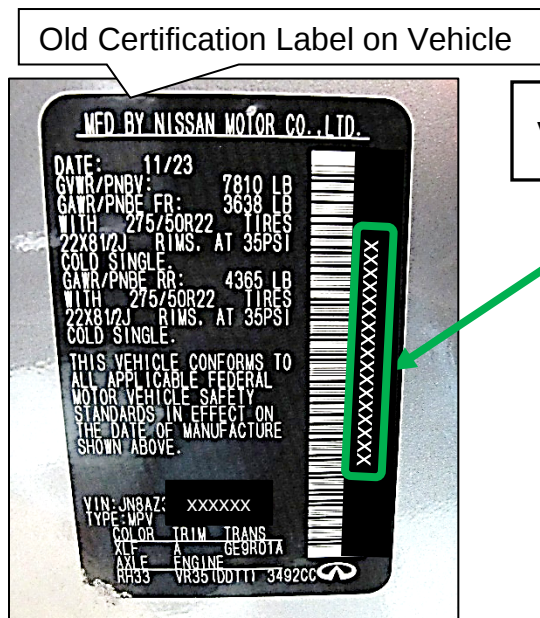


Figure 2

VIN Must Match

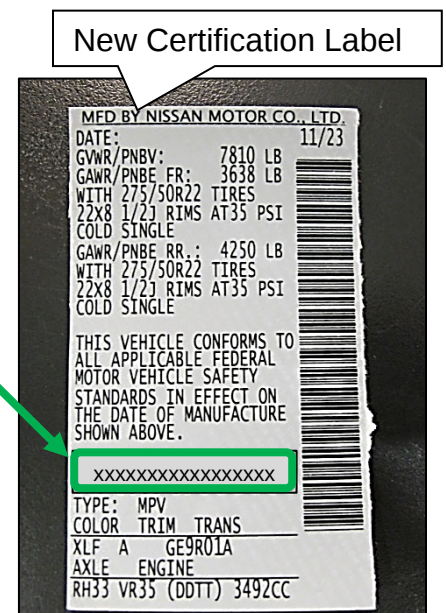


Figure 3

5. Clean the old Certification label and the area around it with a mild detergent and water.

HINT:

- Care should be taken not to use harsh chemicals that may damage the existing label.
- It is important that the surface be free of dirt and oil to ensure proper adhesion of the new label.



Figure 4

6. Completely dry the label and the area around it.
7. Peel the new label from the backing sheet, center it and affix it directly over the top of the existing label.

IMPORTANT:

- The replacement certification label is a different color (Gray) and will be installed over the existing black Certification label. The edges of the black label may be visible.
- The adhesive on the label is permanent. Extra care should be taken when applying the new label since it cannot be moved once it is attached.

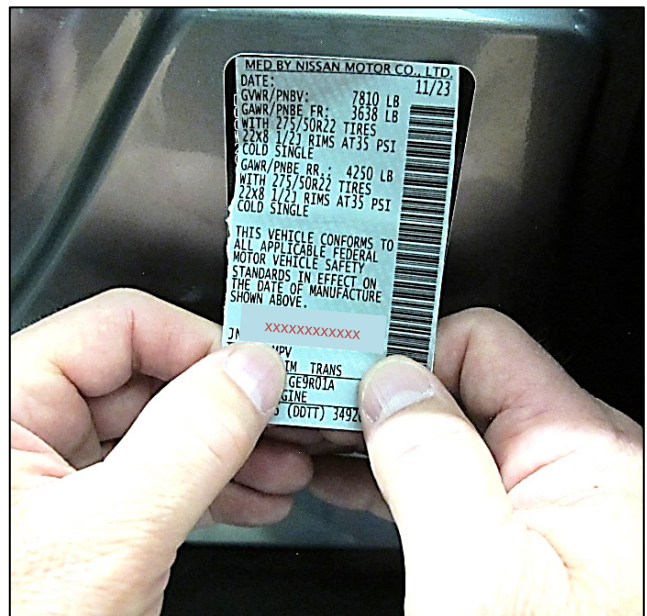


Figure 5

PARTS INFORMATION

- Retailers were supplied with **vehicle specific** replacement Certification Labels for each vehicle in their inventory that is affected by this campaign.
- If the new Certification label has been lost or damaged, the retailer can obtain another one by E-mailing a replacement request to nnafqasupport@nissan-usa.com
- The E-mail size cannot exceed 10 MB.
- Make sure to include the following information below in the E-mail request:
 - o E-mail Subject Line: P6A14 QX80 Certification Label
 - o VIN (On the old Certification Label)
 - o Clear picture of the old Certification Label (Must be able to read VIN)
 - o Retailer Name
 - o Retailer Code
 - o Retailer Address
 - o Contact Person Name
 - o Contact Person E-mail address
 - o Contact Person Phone Number

CLAIMS INFORMATION

CAMPAIGN (CM) I.D. #	DESCRIPTION	OP CODE	FRT
P6A14	Install New Certification Label	P6A140	0.2 hrs.

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
July 17, 2026	ITB26-008	Original bulletin published
August 11, 2026	ITB26-008A	Updated to include 2020-2024 model years

