

TSB 611548 - Recall 26V357

Recall 26V357 - 2026 Ram ProMaster Side Entry — Wheelchair Seat Belt Replacement

Applicability

Year	Make	Model	Entry Style	Conversion Code	Production Date Range	NHTSA Campaign
2026	Ram	ProMaster	Side Entry	CSRPS6 (Conv SE Ram Promaster 3500 LC)	4/1/2026 — 5/18/2026	26V357

! IMPORTANT: Confirm the VIN of the vehicle in front of you matches the affected VIN list provided in your dealer recall letter before beginning this procedure.

Concern

Affected vehicles were built with the Q'Straint One-Combo Belt (**TX11258-BA**) — a single-piece combo belt that is the wrong configuration for this application. It is missing the lap belt portion required to properly restrain a wheelchair-seated person. Improperly restrained occupants have an increased risk of injury in the event of a crash.

Cause

The bill of material (BOM) for these units specified the incorrect wheelchair occupant lap/shoulder belt assembly.

Tools and Materials Required

- Hand tools for the existing top and bottom mounting bolts (reused)
- Torque wrench (capable of 25 ft-lbs)
- **Replacement parts (per vehicle):**

Qty	Part Number	Description
1	604290	Q'Straint Retractable Shoulder Belt, Fixed-Mounted (replaces TX11258-BA)

Qty	Part Number	Description
2	VPM20035	Lap belt — 2 parts (tongue side + buckle side); both required

 **NOTE:** Both halves of VPM20035 are required. They buckle together at the occupant's hip to form a complete lap belt.

Safety Warnings and Precautions

 **WARNING:** Park the vehicle on a level surface and turn the ignition OFF before beginning the procedure.

 **WARNING:** Improperly restrained occupants have an increased risk of injury in the event of a crash. The vehicle must not be released until the new belts are installed and verified.

 **NOTE:** Reuse the original mounting bolts. The defect is in the belt assembly itself, not in the mounting hardware.

Repair Procedure

Step 1: Remove the Recalled Belt

- a. Unbolt the top and bottom of the recalled TX11258-BA combo belt from its mounting points.
- b. Retain the bolts for reuse.
- c. Set the removed TX11258-BA aside for return/disposal per BraunAbility recall instructions.



Step 2: Install the New Shoulder Belt

- Position the new **604290** Q'Straint Retractable Shoulder Belt replacing the TX11258-BA.
- Reinstall using the original bolts retained in Step 1.
- Torque all bolts to 25 ft-lbs.

Step 3: Install the New Lap Belt

Install the new **VPM20035** lap belt sections.

Final Verification

- ☐ Recalled TX11258-BA combo belt removed and set aside for return
- ☐ 604290 shoulder belt installed at the original mounting points using original bolts
- ☐ All bolts torqued to 25 ft-lbs
- ☐ Both halves of the VPM20035 lap belt installed
- ☐ Lap belt halves buckle together at the occupant's hip
- ☐ Buckle latches and releases properly
- ☐ No loose fasteners or tools left in the vehicle

Warranty Claim

File on **BraunAbility Connect+**

Field	Value
Operation	Replacement
Topic 1	WAV
Topic 2	Recall
Topic 3	26V357
Topic 4	Repair
Labor Time	1 hour
