

July 2, 2026

Version 1

Safety Recall: 2018–20 Odyssey Rearview Camera**APPLIES TO**

Year	Model	Trim Level	VIN Range
2018–20	Odyssey	ALL	Check the iN VIN status for eligibility

BACKGROUND

Due to improper manufacturing, cracks may develop in the rearview camera assembly, allowing water to enter. This condition may cause the rearview camera image to not display properly, increasing the risk of a back-up collision or injury.

OWNER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your new or used vehicle inventory.

Failure to repair a vehicle subject to a recall or campaign may subject your dealership to claims or lawsuits from the vehicle owner and/or anyone else harmed as a result of such failure. To verify if a vehicle in inventory is affected, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Replace the rearview camera.

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0551D8	Replace the rearview camera.	0.3hr	6UR00	HOX00	A26092A	39530-THR-A23

PARTS INFORMATION

NOTE: The rearview camera is available through normal ordering in **WARP**. For program details, refer to the Parts Information Bulletin 26-0006.

Part Name	Part Number	Quantity
Rearview Camera Assembly	39530-THR-S01	1

TOOL INFORMATION

Tool Name	Tool Number	Quantity
3.1 mm, 6-inch pick tool with 90° tip	Commercially available	1

NOTE: Honda recommends using the Snap-On Instinct Miniature Pick tool.

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

REPAIR PROCEDURE

1. Click below to view the repair procedure video.

▶ **PLAY VIDEO**

2. Using a suitable pick tool, carefully slide the pick (A) behind the retention tab (B). Push the tab inward toward the camera lens while gently pulling the camera downward to disengage and release the tab.

NOTE: Use a 3.1 mm, 6-inch pick tool with a 90° tip or an equivalent commercially available tool.



3. Repeat the procedure to release the retention tab (A) on the opposite side, then remove the rearview camera.




4. Disconnect and remove the defective rearview camera assembly.

5. Connect the **new** rearview camera harness to the vehicle harness.



6. Insert the harness and camera bracket (A) into the trim. Push the rearview camera assembly into place until the retention tabs lock.

NOTE: Make sure the rearview camera is securely installed.

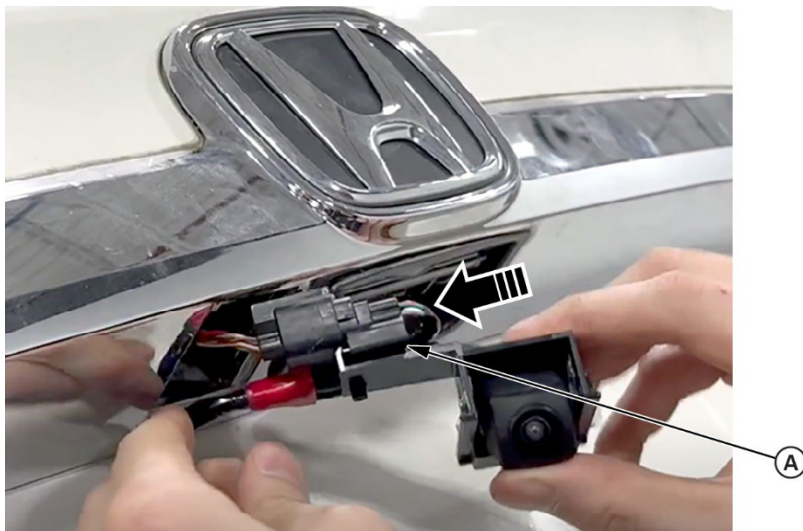

7. With the vehicle **ON**, place the vehicle in reverse and confirm the rear camera is functioning properly.