



FORETRAVEL
MOTORCOACH

Foretravel Service Bulletin

Brake Pressure Switch Recall 26V- 486

Foretravel Dealer:

Introduction: Foretravel has determined on the model year 2025, 2026, Foretravel Realm and FS605P vehicles including a limited number of 2027 Foretravel Realm FS605P vehicles built on an K4 Spartan RV Chassis built between 8/31/2023 - 10/16/2025. The service brake switches may not fully release when the brake pedal is released, causing the brake lights to stay on without any braking action taking place.

Units Affected: Production build #'s 9235 thru 9298. **Not Sequential.**

Units NOT Affected: 9245, 9249, 9259, 9264, 9266, 9275, 9276, 9284, 9285, 9288, 9296 and 9299.

Please Note: Foretravel Motorcoach has 51 vehicles involved with this recall.

Remedy: The recall remedy is to replace the defected brake light pressure switches.

Remedy Results: Release brake pedal to verify that brake lights come on when the pedal is applied and go off when the pedal is in the released position.

Labor: 1 hour

GENERAL INSTRUCTIONS:

Thoroughly review entire service bulletin before starting work. If there are questions or concerns with steps defined in this service bulletin, contact Foretravel Technical Services at 800-955-6226 or Spartan RV Chassis Customer & Product Support Group at 800.393.8861

All applicable industry safety standards must be followed when performing work identified in this procedure.

STEP-BY-STEP INSTRUCTIONS:

1. Verify the coach is in the current population designated by Spartan RV Chassis. Perform a visual check of the normally closed brake switch on the treadle valve of the coach. (Refer to Figure 1 and 2) Remove the carpeted panels in the pedal area to gain access to the pressure switches behind the treadle valve.

Figure 1


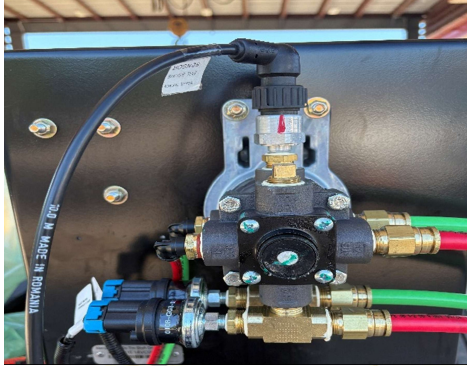


Figure 2



2. Check both of the normally closed brake switches and verify that the manufacturer of the switch is Index. (Refer to Figure 3 for visual indication of manufacturer switch)

Figure 3:

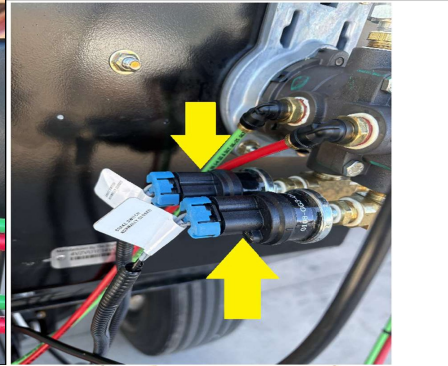

3. If Index switches are present, remove electrical connector from the switches and thread out existing parts. Using industry standard thread sealant replace the switches with provided Honeywell manufacturer switches. Part number: 0108-GG3-015. (Refer to Figure 4)



FORETRAVEL
MOTORCOACH

Figure 4:



4. Verify that both switches have been replaced and all electrical connections have been restored. Apply and release brake pedal to verify that brake lights come on when the pedal is applied and go off when the pedal is in the released position.

When complete file your warranty claim for labor and any other charges that may have been approved and discard old switches as they are not needed for warranty return.

Reminder:

If there are questions or concerns with steps defined in this service bulletin, contact Foretravel Technical Services at 800-955-6226 or Spartan RV Chassis Customer & Product Support Group at 800.393.8861