

February 25, 2026

NONCOMPLIANCE INFORMATION REPORT

1. Vehicle Manufacturer Name:

Toyota Motor Manufacturing, Mississippi, Inc. [“TMMMS”]
1200 Magnolia Way, Blue Springs, MS 38828

Affiliated U.S. Sales Company:

Toyota Motor North America, Inc. [“TMNA”]
6565 Headquarters Drive, Plano, TX 75024

Manufacturer of Headlamp Assembly:

North American Lighting [“NAL”]
2275 S. Main St., Paris, IL 61944
Phone: +1 (217) 465-6600

Country of Origin: USA

2. Identification of Involved Vehicles and Affected Components:

Based on production records, we have determined the involved vehicle population to be the vehicles listed in the table below.

Make/Car Line	Model Year	Manufacturer	Production Period
Toyota / Corolla	2026	TMMMS	November 7, 2025 through November 14, 2025

Applicability	Part Number	Part Name	Component Description
MY2026 Toyota / Corolla	81110-02Q70	Headlamp Assy, RH	Headlamp Assembly, Righthand
	81150-02Q70	Headlamp Assy, LH	Headlamp Assembly, Lefthand

- Note: (1) Although the involved vehicles are within the above production period range, not all vehicles in this range were sold in the U.S.
- (2) This issue only affects the vehicles that were originally equipped with certain headlamp assemblies that were manufactured by a specific supplier during a certain production period. Other Toyota and Lexus vehicles are not equipped with these headlamp assemblies.

3. Total Number of Vehicles Potentially Involved:

86

4. Percentage of Vehicles Estimated to Actually Contain the Noncompliance:

Toyota is unable to estimate the percentage of the involved vehicles to actually contain the noncompliance described in Section 5 because it depends on parts handling during the above production period and whether each vehicle was actually equipped with an affected headlamp assembly. However, as the NHTSA manufacturer portal requires an integer value be entered, Toyota has entered the value “1” in response to this question in the portal. For the purpose of this report, “1” means “unknown”.

5. Description of Noncompliance:

The subject vehicles were equipped with headlamp assemblies that may not include markings on the lens identifying the optical axis. An optical axis marking is required by the FMVSS and is intended to facilitate proper headlamp aiming during service. Although the headlamps were properly aimed at the manufacturing plant, the absence of the optical axis marking results in the vehicles not complying with the requirement in FMVSS No. 108, paragraph S10.18.5.1. If a headlamp is improperly aimed during service due to the absence of the required optical axis marking, certain adjustments could increase glare to oncoming drivers or reduce forward visibility for the driver of the subject vehicle. Either condition may increase the risk of a crash.

6. Test Results and Other Information:

In November 2025, during a vehicle audit the vehicle manufacturing plant observed that a vehicle's headlamps were missing the optical axis marking. Toyota identified that the supplier recently underwent a tooling change and the new tooling was missing the optical axis marking. Toyota issued a vehicle hold and repair activity at vehicle processing facilities for vehicles which may have been equipped with headlamps produced with this tooling. Toyota identified certain vehicles had flowed out of the vehicle processing facilities to the market. Based on this information, Toyota determined on February 19, 2026 that the vehicles identified in Section 3 above were sold with headlamp assemblies that may not meet the requirements of FMVSS No. 108, paragraph S10.18.5.1.

7. Description of Corrective Repair Action:

All known owners of the subject vehicles will be notified to return their vehicles to a Toyota dealer. For all involved vehicles, dealers will replace the left and right headlamp assemblies, free of charge.

Reimbursement Plan for pre-notification remedies

As the owner notification letters will be mailed out well within the active period of the Toyota New Vehicle Limited Warranty ("Warranty"), all involved vehicle owners for this recall would have been provided a repair at no cost under Toyota's Warranty.

8. Recall Schedule:

Notifications to owners of the affected vehicles will occur by April 26, 2026. A copy of the draft owner notification will be submitted as soon as it is available.

9. Distributor/Dealer Notification Schedule:

Notifications to distributors/dealers will be sent on February 25, 2026. Copies of dealer communications will be submitted as they are issued.

10. Manufacturer's Campaign Number:

Remedy: 26TA05