



---

**Nissan North America, Inc.**

One Nissan Way  
Franklin, TN 37067

Mailing Address:  
PO Box 685001  
Franklin, TN 37068

April 9, 2026

Ms. Eileen Sullivan  
Associate Administrator for Enforcement  
National Highway Traffic Safety Administration  
Attn: Recall Management Division (NVS-215)  
Room W48-302  
1200 New Jersey Avenue, SE  
Washington, D.C. 20590

Dear Ms. Sullivan:

We are transmitting the enclosed Defect Information Report in accordance with 49 CFR Part 573. A voluntary recall campaign will be initiated, and your office provided with the notices.

Very truly,

A handwritten signature in black ink, appearing to read "Will Swindell".

Will Swindell  
Manager,  
Technical Compliance

Encl.

## DEFECT INFORMATION REPORT

1. Manufacturer:

Nissan Motor Company, Ltd

2. Vehicles Potentially Involved:

The production period of affected vehicles involved is shown in the table below:

<b><u>Model</u></b>	<b><u>Dates of Manufacture</u></b>	<b><u>Manufacturing Plant</u></b>
MY 2009-2010 Nissan Cube	October 10, 2008 through September 25, 2010	Oppama

This defect (as described in Section 5 below) is specific to Model Year 2009-2010 Nissan Cube vehicles equipped with Takata PSDI-X driver's airbag inflators that were produced within a specific LOT number. No other Nissan or INFINITI vehicles are equipped with this inflator.

The name, description and part number of the subject air bag inflator is below:

<b><u>Part Name</u></b>	<b><u>Part Description</u></b>	<b><u>Part Number</u></b>
Driver Airbag Inflator	Airbag Inflator Type PSDI-X, Driver's Side	98560-7991C

The name and address of the front passenger airbag inflator supplier is:

TK Services Inc.  
111 Peyerk Court  
Romeo, MI 48065

3. Total Number of Vehicles Potentially Involved:

Approximately 47,928 total Model Year 2009-2010 Cube vehicles may be affected:

4. Percentage of Vehicles Estimated to Actually Contain the Defect:

The defect is estimated to be present in 0.002% of vehicles.

5. Description of the Defect:

The driver's airbag inflator on certain Nissan Cube vehicles may contain an improper body weld seal to the inflator base. As a result of this improper weld, the airbag module may

detach from the steering wheel during airbag deployment. If this condition occurs, it may increase the risk of injury to the occupant in the event of a crash where driver's airbag deployment is warranted.

6. Chronology of Principal Events:

Chronology to be supplemented.

7. Description of Corrective Action:

Dealers will be notified on April 23, 2026. Owners of all potentially affected Cube vehicles will be notified beginning on May 27, 2026, to bring their vehicle to a Nissan dealer. Dealers will be instructed to check the serial number on the driver's airbag inflator for a specific LOT number. If the inflator is part of the suspect LOT, the dealer will remove the inflator and replace it with a new inflator manufactured by a different supplier. All repairs will be performed free of charge for parts and labor and may take less than one (1) hour to complete.

Nissan will include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy for vehicles which are no longer under warranty.

8. Copy of Notices:

Copies of all notices will be provided to NHTSA as they become available.