

10000999



SI B72 04 02
Safety Restraint Systems

January 2003
Service Engineering

This Service Information bulletins supersedes S.I. B72 04 02 dated January 2003.

■ designates changes to this revision

SUBJECT

Airbag Warning Light On, FC 986B or 98EB Stored

MODEL

B85 (Z4) Vehicles produced up to December 10, 2002

SITUATION

The airbag warning light is on, and ignition circuit resistance faults are set in the "B" pillar satellite sensors - fault code 986B for SBSL and 98EB for SBSR. The faults may be set individually, or together. Also, fault code 20 is stored in the Instrument Cluster.

CAUSE

Door harness terminals damaged during the vehicle assembly process.

CORRECTION

Replace the appropriate door harness and delete all fault codes

Note: The replacement harness is supplied with a special grease pre-applied to the terminals. Do not apply Stabilant 22A.

PARTS INFORMATION

Part Number	Description	Quantity
61 12 6 926 841	Door harness (left)	1
61 12 6 926 844	Door harness (right)	1

■ **WARRANTY INFORMATION**

Covered under the terms of the BMW New Vehicle Limited Warranty.

Defect Code 61 12 90 60 00

Labor Operation: Read fault memory, replace left door harness, delete fault codes

Labor Operation	Labor Allowance
00 54 043	16 FRU
+00 54 571	15 FRU

Labor Operation: Read fault memory, replace right door harness, delete fault codes

Labor Operation	Labor Allowance
-----------------	-----------------

10000999

00 54 044 16 FRU

+00 54 572 15 FRU

Labor Operation: Read fault memory, replace both door harnesses, delete fault codes

Labor Operation	Labor Allowance
------------------------	------------------------

00 54 045	16 FRU
-----------	--------

+00 54 573	15 FRU
------------	--------

Note:The following explanations will spell out the correct use of the work times.

Main Work: Use this labor operation number when the only repair performed is the listed warranty repair.

OR

+Associated Work: Use this labor operation number when other repairs or services are performed along with the listed warranty repair. Under no circumstances should both labor operation numbers be claimed. Attempts to claim both times will result in an unnecessary delay in claim processing and payment.

[Copyright © 2003 BMW of North America, LLC]