

## CHASSIS TECH TIPS

### Subject:

### “ABS” LIGHT ON and ALLISON TRANSMISSION SHIFTING ERRATICALLY

#### 1. RELEVANT MODELS:

2005 thru 2010 Conventional models equipped with an Allison transmission.

#### 2. CONDITION:

In the event of an active ABS fault the Allison transmission will not allow torque convertor lockup. **If this condition is ignored the transmission fluid may overheat, causing fluid to be pumped out of the transmission breather and or dipstick tube which can lead to a premature transmission failure.**



Active ABS Fault - ABS Warning Light

#### 3. DIAGNOSIS:

Check transmission fluid. Verify that there are no active or inactive ABS fault codes before road testing or condemning transmission.