

Service Bulletin

Service Bulletin # TS-0025: Load Guide Relocation

Condition: Potential for Load Guide Mounting Bracket to Break

Trailer Models Affected:

2011 Model Year LPG15/16, PG165, PT175/190, TAR1782

2012 Model Year PG165/175, PRO175, PT175/190

Labor Code & Time: B69 .3 HR

Bulletin Information

DESCRIPTION OF CONCERN:

It has been determined that the load guides on the affected models manufactured between April 26, 2010 and September 1, 2011 have the potential to break at the bend in the mounting bracket due to vibration and resulting in metal fatigue if left in the rearmost mounting location as shown in Figure 1.

Please perform this bulletin to any retail consumer's trailer that is affected.

VERIFICATION PROCESS:

Inspect the mounting bracket for evidence of metal fatigue or cracking. Replace any load guides that display this condition.

CORRECTIVE ACTION:

Corrective action for this condition is to inspect the load guides for evidence of metal fatigue or cracking and relocate from rear-most mounting position to forward position as shown in Figure 2. Replace any affected load guides with part #115426 (3") or part #115427 (4") load guide kits. The part number required will be determined by model and serial number of trailer as designated on the bill of material by a 3" or 4" component.

Direct any questions to Tracker Marine Group Warranty Department at 866-378-2529.



Figure 1

1. Remove load guide from rear step box hole.
2. Use the bolt, washers and nut from load guide to reassemble the rear portion of the box.
3. Apply these steps to both left and right sides.





New Location

Figure 2

4. Remove bolt, washers and nut from the front end of the rear step box hole.
5. Use the bolt, washers and nut to reassemble the front end portion of the rear box.
6. Apply these steps to both left and right sides of trailer for completion.