

XENTRY

Cracking noises at the front seats when operating the height adjustment

Topic number	LI91.10-P-051831
Version	1
Design group	91.10 Front seats
Date	05-12-2011
Validity	MODEL 220.### ## up to 264959
Reason for change	Damage code adapted
Reason for block	

Complaint:

Cracking noises at the front seats when operating the height adjustment.

Cause:

Cracking noises when operating the height adjustment.

Remedy:

- 1 Move front seat height adjustment upwards.
- 2 Detach plastic cover (1) from seat.
- 3 Grease tubular frame with lubricant at the mounting hole for the plastic cover (1) on the inside.
- 4 Reattach plastic cover (1) to seat.

Repair materials

Number Designation Order number

BR00.45-Z-1064-06A Special sliding compound A 000 989 36 60

Attachments	
File	Designation
P91.10-2483-11.jpg	1 Plastic cover

Symptoms
Seat / Seat noises / Body / Cracking /
Seat / Seat noises / Body / Grunting /
Seat / Body / Seat adjustment / Noise /

Parts						
Part number	xsl-Par-tEs1	xsl-Par-tEs2	Designation	Quantity	Note	EPC Non-EPC
A0009893660			Special sliding compound	1	Product from Noise Damping Service Kit (A 000 580 03 50)	X

XENTRY

Work units				
Op. no.	Operation text	Time	Damage code	Note
			91A0A 36	Electric seat adjustment, left front seat
			91N0A 36	Electric seat adjustment, right front seat

WIS-References			
Document number	Title	Note	Allocation
BR00.45-Z-1064-06A	WIS reference		Remedy

Validity		
Vehicle	Engine	Transmission
220.025	*	*
220.026	*	*
220.028	*	*
220.063	*	*
220.065	*	*
220.067	*	*
220.070	*	*
220.073	*	*
220.074	*	*
220.075	*	*
220.083	*	*
220.084	*	*
220.087	*	*
220.125	*	*
220.126	*	*
220.128	*	*
220.165	*	*
220.167	*	*
220.170	*	*
220.173	*	*
220.174	*	*
220.175	*	*
220.176	*	*
220.178	*	*
220.183	*	*
220.184	*	*
220.187	*	*
220.875	*	*

220.878	*	*
---------	---	---

Attachments

P91.10-2483-11.jpg:

