


- Select **Download** for the rear mech.  
NOTE: If the Download button is grayed out, select **Return**, then eject the disc. Stay on the Select Check Units Screen, then reinsert the update disc. Wait at least 20 seconds before selecting **DVD Mech**.



- When the confirmation screen appears, select **Yes**, and the loading screen appears. The update takes about 5 minutes.  
When the update is done, the system reboots.

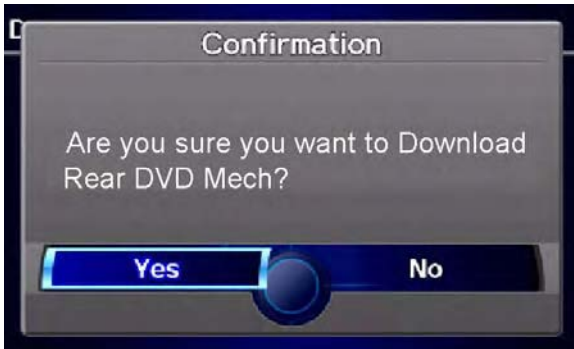

- After the system reboots, eject the update disc.



- Turn the ignition switch to LOCK (0) for 10 seconds.
- Start the engine.
- Enter the Diagnosis Mode. Select **Detail Information & Setting, Unit Check**, then select **DVD Mech**.

- Confirm that the rear mech software version is **7.3000**.



- Center-punch a completion mark above the first character of the engine compartment VIN:

Center-punch here.



*Example of Customer Letter*

December 2011

**Product Update: CD or DVD (RES) Restarts When the Ignition Switch Is Cycled**

Dear Honda Owner:

This letter is to notify you of a potential problem with your vehicle and what you should do to resolve it.

**What is the problem?**

There may be a software problem that causes the CD player or rear entertainment system (RES) to restart the disc from the beginning when the ignition switch is turned OFF, then back ON.

**What should you do?**

Contact any authorized Honda dealer for an appointment to have your vehicle's audio-navigation software updated. This work will be done free of charge. Please plan to leave your vehicle at the dealer for half a day to allow them flexibility in scheduling.

**Lessor Information**

If you are the vehicle lessor receiving this product update notice, please forward a copy of this notice to the lessee.

**If you have questions**

If you have any questions about this notice, or need assistance with locating an Honda dealer, please call Honda Automobile Customer Service at 1-800-999-1009, and select option 4. You can also locate a dealer online at *Hondacars.com*.

Sincerely,

**American Honda Motor Co., Inc.  
Honda Automobile Division**