



Service Bulletin

File in Section: -

Bulletin No.: PI0461D

Date: October, 2012

PRELIMINARY INFORMATION

Subject: Supplemental Repair Required for HVAC Condenser Inoperative/Replacement Due to Stone/Foreign Material Impact

Models: 2011-2012 Chevrolet Cruze Excluding RPOs WA7 and BVG
Built Prior to October 01, 2011

This PI is being revised to provide RPO information. Please discard PI0461C.

Condition/Concern

Some customers may comment on any of the following conditions:

- A/C inoperative
- A/C will not blow cold air
- A/C blows hot
- Leaking refrigerant

The condenser may become inoperative due to frequent/heavy stone/foreign material impact.

Recommendation/Instructions

After replacing the condenser, install the condenser screen that snaps over the front of the existing condenser. This will prevent foreign material that comes through the front grille making contact with the new condenser causing damage.

Parts Information

Part Number	Description
22869501	Condenser
95927464	Condenser Screen

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
D3140	Air Conditioning Condenser Replacement	Use Published Labor Operation Time
Add	To Recover and Recharge A/C System	0.3 hr