



Service Bulletin

File in Section: -

Bulletin No.: PI0807A

Date: November, 2012

PRELIMINARY INFORMATION

Subject: Exhaust Rattle Noise

Models: 2011-2012 Chevrolet Camaro Convertible
Equipped with V8 L99 Engine

This PI is being revised to update the Parts Information. Please discard PI0807.

Condition/Concern

Some customers may comment on an exhaust rattle or noise when at idle or slow vehicle speeds up to 1300 engine rpm.

The spring in the exhaust valve may be causing the exhaust to rattle or make noise.

Recommendation/Instructions



2898702



2898703

Technicians should follow the procedure below and install two silicone O-rings over each of the exhaust valve springs to dampen the rattle.

1. Raise the vehicle.
2. Install two O-rings onto the left exhaust valve spring.
3. Install two O-rings onto the right exhaust valve spring.
4. Lower the vehicle.

Parts Information

Part Number	Description	Quantity
23105943	DAMPENER EXH PIPE (O-RING)	4

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
L9732*	Install O-rings to Exhaust Springs	0.2 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		