



Service Bulletin

File in Section: -

Bulletin No.: PI0818

Date: September, 2012

PRELIMINARY INFORMATION

Subject: Vehicle Remote Start Inoperative and DTC B3006 Set After BCM Reprogram

Models: 2012 Chevrolet Orlando (Canada Only)

Condition/Concern

The vehicle remote start may be inoperative, after reprogramming the body control module (BCM) with a DTC B3006 set.

The incorrect BCM calibration was released in the service programming system (SPS).

Recommendation/Instructions

DO NOT replace the hood switch or wiring. Call the Techline Customer Support Center (TCSC) for a VCI number to revert the as built BCM calibrations.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
N4808	Body Control Module Reprogramming with SPS	Use Published Labor Operation Time