



Service Bulletin

File in Section: -

Bulletin No.: PI0854

Date: November, 2012

PRELIMINARY INFORMATION

Subject: Front Door Wind Noise

Models: 2013 Chevrolet Sonic
Condition/Concern

Some customers may comment on front door wind noise.

Recommendation/Instructions

The wind noise may be coming from the die relief notch in the door. Cover the notch with tape following the procedure below:

1. Lower the front door window.



2. Carefully pull down the upper rear corner of the glass run channel weatherstrip.
3. Cut a piece of Posi-Seal Plus™ approximately 50 mm X 40 mm long.

2968996



2968998



2968999

4. Apply the tape over the die relief notch (arrows) making sure not to cover the small gage notch (circled). Refer to the photos above.
5. Reinstall the upper rear corner of glass run channel weatherstrip.

Parts Information

Part Number	Description	Qty	Material Allowance
KT13080*	Posi-Seal Plus™–Kent (2½ x 2½ Pads)	1	\$2.50 Per Vehicle

*This product is currently available from Kent Industries (1-888-YES-KENT).

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
B6835*	Install Tape to Correct Front Door Wind Noise	0.2 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		