

Service Bulletin

PRELIMINARY INFORMATION


Subject: Driver Carpet Footrest Cover Loose or Dislodged from Carpet Base

Models: 2013 Cadillac ATS Built Prior to October 8, 2012 Condition/Concern

Some customers may comment that the driver footrest cover is loose or is dislodged from the carpet. The cause of this condition may be that the upper snap feature of the footrest cover won't stay retained to the carpet footrest base.


Recommendation/Instructions

Use hot melt, GM P/N 12377914 (In Canada, P/N 88864881), to reattach the footrest cover to the base following the steps below:

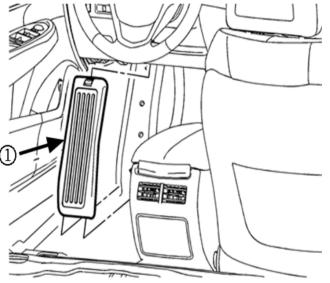

3213875

1. Completely remove the footrest cover (1) from the carpet base. Refer to Driver Footrest Replacement in SI.

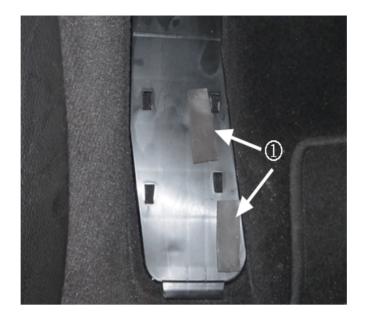


3213877

- 2. Inspect the carpet footrest base for any foam tape (1) or adhesive residue and remove as necessary. Clean the base with rubbing alcohol or equivalent.
- 3. Before the hot melt is applied, practice installing the cover several times to the base. Note that the cover has retaining tabs that must slide into the lower edge of the base first, then snap into the base at the top.



3213878

Note: The approximate locations for the hot melt application are shown in the illustration above.

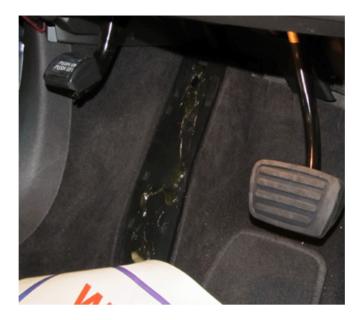

3213879

4. Using a heat gun, carefully apply five nickel size pools of hot melt to the carpet base. Apply quickly to help minimize the glue running down the base.



3213880

Note: The hot melt should cure in approximately 30 seconds, plus another 15 seconds to ensure the glue is cooled and cured.

5. Immediately install the cover to the base, then firmly press and hold the cover to the base for approximately 45 seconds. Do not disturb the cover for a few minutes, allowing it to fully cure.

Parts Information

| Part Number | Description |
|-----------------------|---------------------------|
| 12377914 | ADHESIVE STICKS, HOT MELT |
| (In Canada, 88864881) | |

Warranty Information

For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|--|---|------------|
| C9536* | Re-secure Driver Footrest Cover with Hot Glue | 0.2 hr |
| *This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide. | | |