



# Service Bulletin

File in Section: -

Bulletin No.: PI0878

Date: December, 2012

## PRELIMINARY INFORMATION

**Subject:** SERVICE PARK ASSIST Message Displayed - DTC B0954, B0955, B0956 or B0957 Set

**Models:** 2012-2013 Buick Regal GS  
Equipped with Sensor Indicator - Parking Assist (RPO UD5)

**Attention:** The Parking Assist System works properly. This information is being provided to assist in diagnosis of the system if any issues were to occur.

### Condition/Concern

Some customers may comment on a SERVICE PARK ASSIST message being displayed.

Upon investigation the technician may observe on a scan tool DTC B0954, B0955, B0956 or B0957 set.

Using the published Service Information for diagnostic trouble codes, DTC B0954, B0955, B0956 or B0957 will not result in proper diagnosis.

The forward lamp wiring harnesses on the Regal GS model have been manufactured crossing the left and right sides. Although the left side and right side are reversed, the inboard-outboard association has been maintained.

**For example, when a condition exists that sets a DTC for the right-hand inboard sensor, the DTC that actually sets will be for the left-hand inboard sensor.**

Due to this condition, and only on the Model Year 2012-2013 Regal GS vehicles, to properly diagnose a given DTC, the other "handed" DTC **MUST** be followed.

This wiring harness condition **will be** corrected for the Model Year 2014 Regal GS vehicles.

### Recommendation/Instructions

**Notice:** Reference the following list of diagnostic trouble codes set and the DTC diagnostic to follow in order to properly diagnose.

Diagnostic Trouble Code (DTC) Set	Use Diagnostic
B0954 - Any Symptom Code	B0957 With Same Symptom Code
B0955 - Any Symptom Code	B0956 With Same Symptom Code
B0956 - Any Symptom Code	B0955 With Same Symptom Code
B0957 - Any Symptom Code	B0954 With Same Symptom Code