



Service Bulletin

File in Section: -

Bulletin No.: PIC5321A

Date: December, 2012

PRELIMINARY INFORMATION

Subject: Various Electrical Problems

Models: 2010 - 2011 Cadillac DTS

This PI was superseded to update model years and warranty information. Please discard PIC5321.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern


In rare cases a customer may comment on the SES light on, "Service Brake System", "Service Power Steering" message on the DIC, and/or power door locks cycling accompanied by a possible DTC C0450. The brake and steering systems will continue to function as designed.

There may be an engine harness rubbing through on the lower front part of the transmission. The concern may not be limited to these conditions alone since this is a main wiring harness.

Recommendation/Instructions

If harness is pinched (1), reroute harness, inspect for damaged wiring and repair as necessary.

Install harness clip on transmission stud as necessary (2).

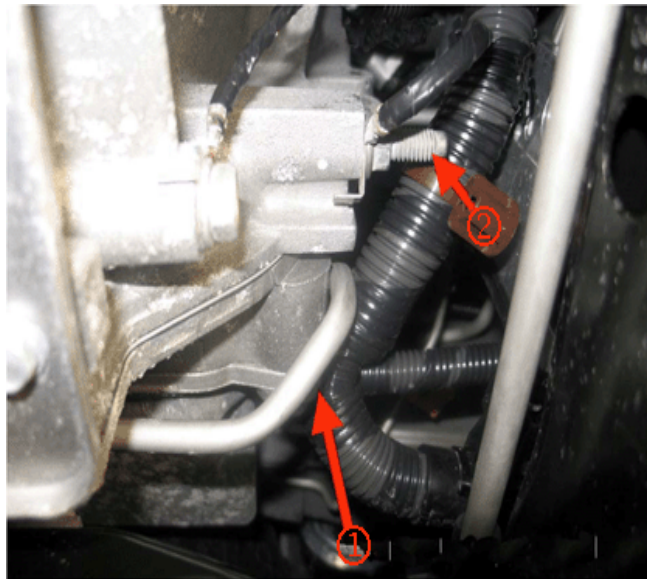

2390750

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.