

WC47 - Checking Engine-oil Level and Correcting it if Necessary (Workshop Campaign)

Vehicle Type: **Panamera S Hybrid**

Model Year: **As of 2012 up to 2013**

Country/Market: USA (C02)

Concerns: **Engine-oil level**

Information: This is to inform you of a voluntary Workshop Campaign on the above-mentioned vehicles.
Engine oil consumption might increase during the vehicle's run-in period in some cases.
As a result, it may be necessary to top up the engine oil even on vehicles with low mileage.

Action Required: Check engine-oil level and correct it if necessary.

Affected Vehicles: Only the vehicles assigned to the campaign, if these vehicles come into the workshop in the period from **November 2012 to May 2013 outside of a regular service** (i.e. not for a scheduled oil change service or intermediate maintenance, maintenance, etc.). This campaign affects 271 vehicles in the United States.

Materials: Engine oil*
* The WWS Warranty system will automatically add into the "Miscellaneous item" section (sublet) of the claim after the claim has been submitted.

Tools: **T40178 - Oil gauge tester**

Work Procedure: See Attachment "A".

Claim Submission: See Attachment "B".

Attachment "A": **Work Procedure**

- 1 **Read off the engine-oil level** from the **oil level display in the instrument cluster** according to the instructions in the Owner's Manual (Main menu "**Vehicle**" > "**Oil level**").

- 2 **Only** if the engine-oil level that is read off the oil level display in the instrument cluster as shown in ⇒ *Figure 1* is **at least two segments below the MAX marking**: Measure the engine-oil level as described in ⇒ *Workshop Manual '170101 Checking engine-oil level'* using the **oil gauge tester T40178** and add engine oil up to the MAX value if necessary (invoicing: Scope 2).

Otherwise: End of action required (invoicing: Scope 1).

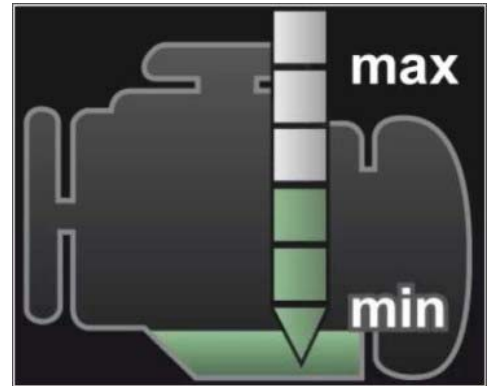


Figure 1



Information

To avoid overfilling and depending on the measured oil level, estimate the actual amount of oil to be added and top up the engine oil gradually by adding a small quantity at a time. Once you have topped up the engine oil, wait approx. 2 minutes and then check the oil level again.

Do **not** enter the workshop campaign in the Warranty and Maintenance booklet.

Attachment "B": **Claim Submission** - Workshop Campaign WC47

Warranty claims should be submitted via WWS/PQIS.

Open campaigns may be checked by using either the PIWIS Vehicle Information system or through PQIS Job Creation.

Labor, parts, and sublet will be automatically inserted when Technician is selected in WWS/PQIS. If necessary, the required part numbers will need to be manually entered into warranty system by the dealer administrator.

Scope 1: Checking engine-oil level. There is **no need** to add more engine oil.

Working time:

Checking engine-oil level

Labor time: **10 TU**

⇒ **Damage code WC47 066 000 1**

Scope 2: Checking engine-oil level **and** adding engine oil.

Working time:

Checking engine-oil level and adding engine oil

Labor time: **20 TU**

Parts required:

WC470000001 Engine oil

1 ea.

(= approx. 1 litre, for warranty invoicing only*)

* The WWS Warranty system will automatically add into the "Miscellaneous item" section (sublet) of the claim after the claim has been submitted.

⇒ **Damage code WC47 066 000 1**

Important Notice: Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers.

© Porsche Cars North America, Inc.

Dealership	Service Manager	Shop Foreman	Service Technician
Distribution	Asst. Manager	Warranty Admin.	Service Technician
Routing			

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman™, Panamera®, Tiptronic®, VarioCam®, PCM®, 911®, 4S®, FOUR, UNCOMPROMISED.® and the model numbers and distinctive shapes of Porsche's automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Some vehicles may be shown with non-U.S. equipment. Porsche recommends seat belt usage and observance of traffic laws at all times.

Printed in the USA