

REFERENCE:	Nova Bus Manuals
SECTION:	18 Articulation system
RS N°:	MQR 7621-528
EFFECTIVE IN PROD.:	L584

APPLICATION DEADLINE:
2013OC30

SUBJECT:	Articulation platform rubber trim
JUSTIFICATION:	Probable lateral displacement of the articulation platform rubber trim.

LEVEL	DESCRIPTION	DIRECT CHARGES		TIME
		LABOUR	MATERIAL	
1	Replace with a 1 in. diameter washer at the extremities of the articulation platform.	Nova Bus	Nova Bus	15 min
2	–	–	–	–

MATERIAL

QTY	PART N°	REV.	DESCRIPTION	REPLACES PART N°
LEVEL 1				
2	N64081	–	1 in. (25 MM) Washer	N47853
LEVEL 2				
–	–	–	–	–

Materials will be available within 7 days. To order, please contact Prevost Parts by phone at 1-800-771-6682, by fax at 1-888-668-2555 or by email at prevostparts.commandes@volvo.com. Specify document number, quantity of parts required and shipping address.

DISPOSAL OF PARTS

REMOVED PARTS ARE:	DISCARDED *	RETAINED	* Dispose of the unused parts and the defective parts in accordance with local environmental standards in effect.
	Yes	–	

REVISION HISTORY

REV.	DATE	CHANGE DESCRIPTION	WRITTEN BY
NR	2012SE31	Initial release	Wilder Galiano
R1	2012OC30	Add L681-01 to 98 to customer list	Wilder Galiano

APPROVED BY:

Karine Allonce

Digitally signed by Karine Allonce
DN: cn=Karine Allonce, o=Novabus, ou,
email=karine.allonce@volvo.com, c=CA
Date: 2012.10.23 13:42:27 -04'00'

CLIENT	ORDER	ROAD NUMBER		VIN (2NVY/4RKY...)		QTY
		FROM	TO	FROM	TO	
New York City Transit - New York	L670	5771	5896	S92U9B4000147	S92U1B4000160	125
New York City Transit - New York	L681	5253	5986	S92U2C4500023	S92U6C4500171	98

**WARNING**

Follow your internal safety procedures.

PROCEDURE

**NOTE**

The procedure applies to both sides of the vehicle (street and curb side) for the articulation plate.

1.1. Detach the floor cover attached to the side of the four-seat installation. See Figure 1. Retain the rubber trim.

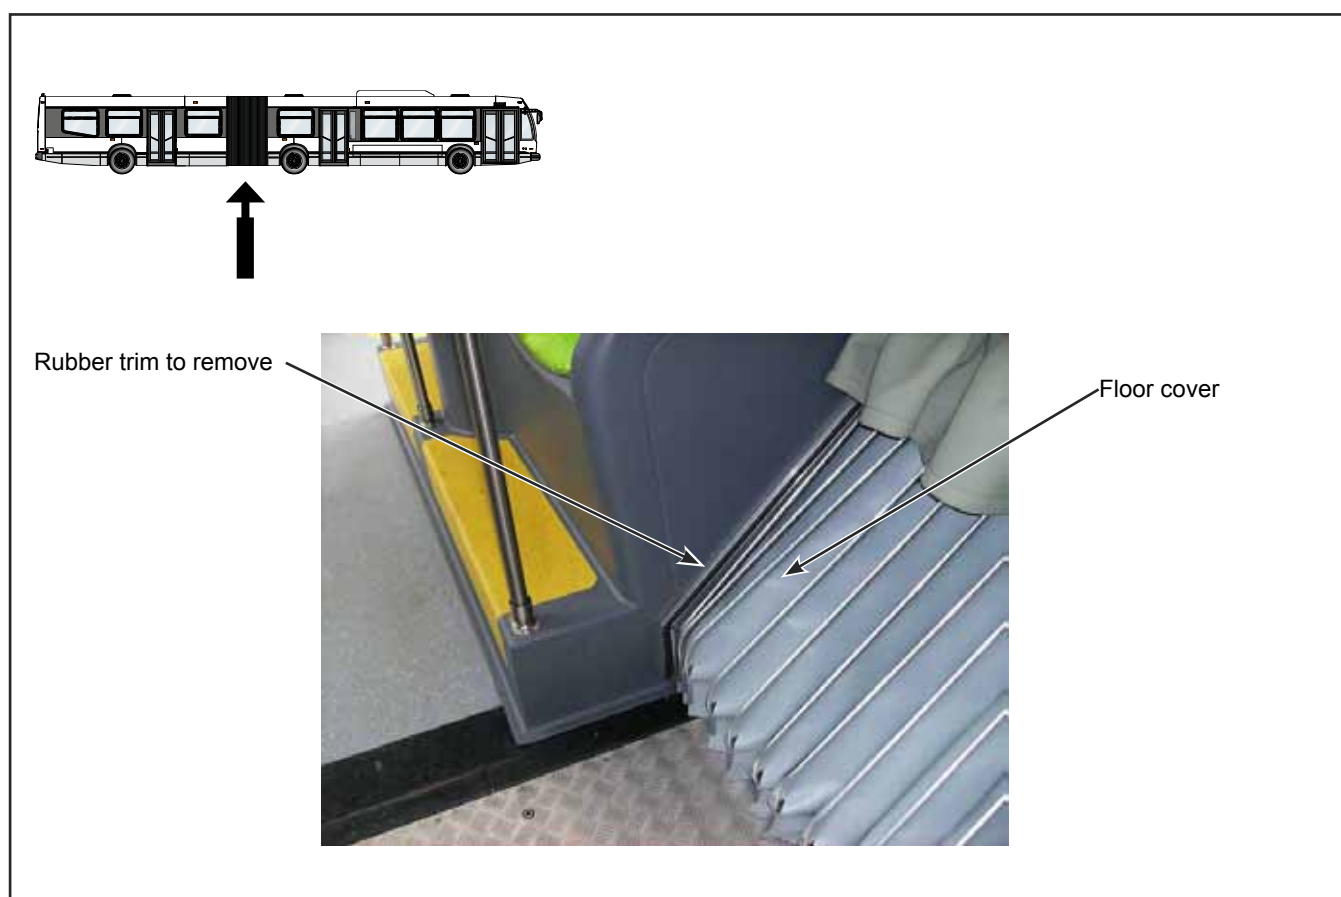


Figure 1 - Floor Cover to Detach

- 1.2. Remove the bolt with the washers. See Figure 2. Retain the hardware, except the 5/8 in (15 mm) washer, which must be discarded.

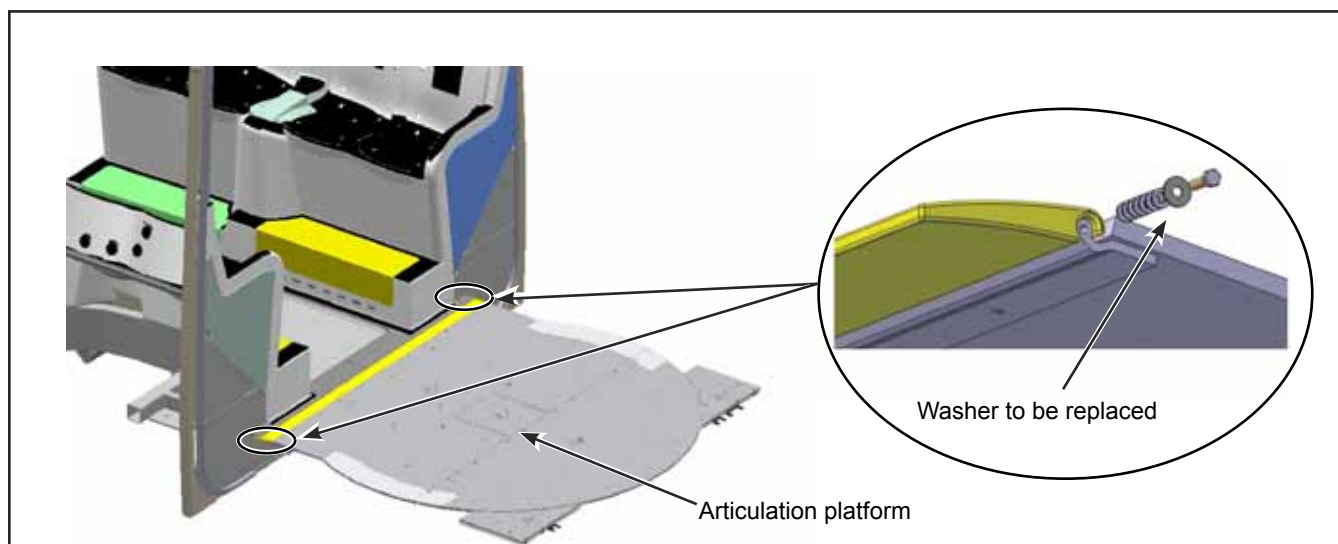


Figure 2 - Washers to be Replaced

- 1.3. If required, replace the floor trim to eliminate any gap in the joints. See Figure 3.

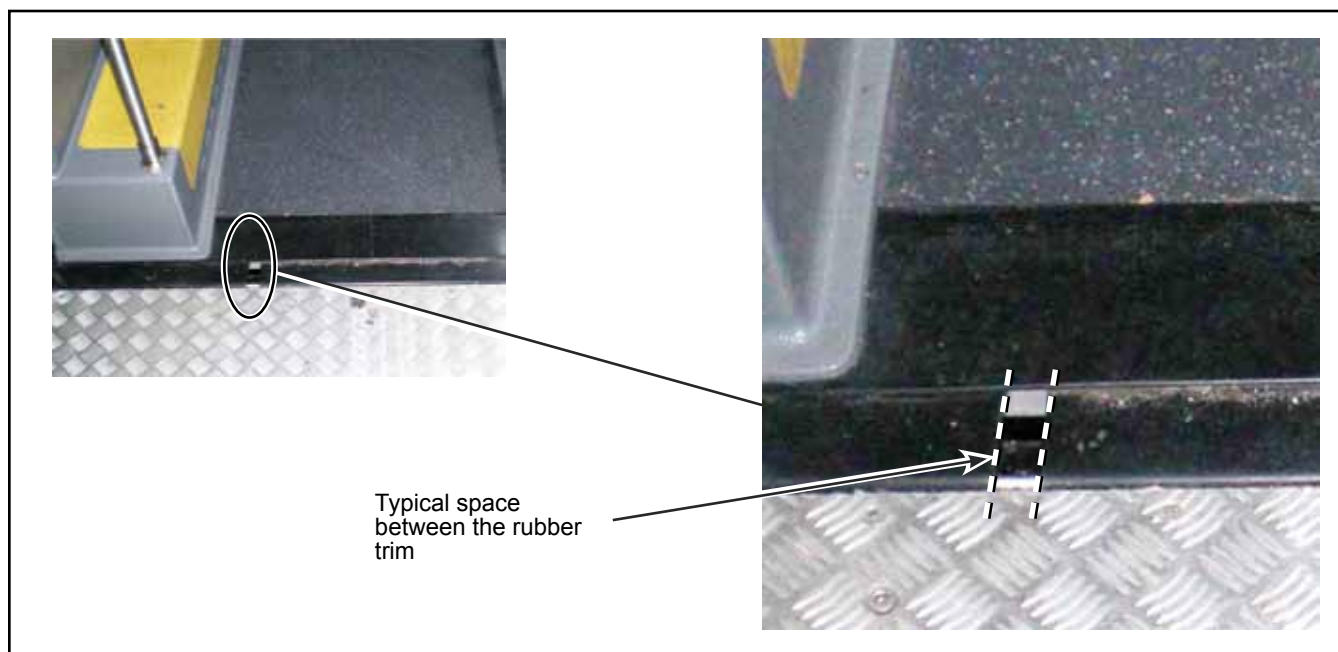


Figure 3 - Typical Space Between Floor Trim

- 1.4. Install the retained hardware, replacing the 5/8 in. (15 mm) washer with a 1 in. (25.4 mm) washer N64081. See Figure 4.



Figure 4 - New Washer Installation

- 1.5. Attach the edge of the floor cover to the lateral seat attachment points.
- 1.6. Install the retained rubber trim to affix the floor cover to the lateral seat. See Figure 5❖



Figure 5 - Rubber Trim Installation