



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Multiple DTCs Set When Using Scan Tool Device

**Models:** 2013 Cadillac ATS  
2010 - 2013 Cadillac SRX

*This PI was superseded to update recommended field. Please discard PIC5741A.*

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

Multiple DTCs set and Instrument Panel Self-Test/WOW occurs when the MDI is plugged into the vehicle's Diagnostic Link Connector (DLC). This condition may be aggravated by slightly wiggling the connection at the DLC. This can be caused by a poor electrical connection to the MDI caused by spread terminals in the DLC. Most frequently, DLC ground terminals 4 & 5 are the culprit, however, but it could be the positive connections as well.

### Recommendation/Instructions

Use diagnostic test probe J-35616-2A (GY) to test for spread terminals. If replacement terminals are required, they are part number 50420-8000 and are located in tray 15 of the terminal repair kit.

### Warranty Information

For vehicles repaired under warranty, please use the appropriate warranty labor operation based on the actual cause and repair. The latest version of bulletin 10-00-89-005: "Warranty Administration - Revised Wiring Repair Labor Operations and Required Additional Information" can use as a reference.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

### ADDITIONAL SI KEYWORDS:

communication GDS2 no U0001 U0002 U0020 U0073 U0074 U0077 U0100 U0101 U0102 U0109 U0121 U0125 U0126 U0128 U0130 U0131 U0140 U0151 U0155 U0158 U0159 U0164 U0167 U0168 U0170 U0181 U0182 U0184 U0186 U0193 U0198 U0201 U0203 U0204 U0207 U0208 U0209 U0210 U0232 U0233 U0236 U0237 U023A U0255 U0256 U0257 U0264 U0265 U0268 U0269 U026A U026B U180D U1826 U1827 U1833 U183A U184A U184B U184C U184D U184E U18A3 U2099 U209E U209F U2100 U2101 U2103 U2105 U2106 U2107 U2108 U2125 U2127 U2144

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION