

Service Bulletin

PRELIMINARY INFORMATION

Subject: Blower Motor Inoperative and/or Water In Blower Motor Control Module Area DTC B0193

Models: 2013 Chevrolet Malibu eAssist

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer or technician may indicate the blower motor is inoperative and/or there is water in the blower control module motor area. DTC B0193 may also be set.

Recommendation/Instructions

If this concern is duplicated inspect the blower motor, blower motor control module and connectors for signs of water. If water is found it will be necessary to reseal the plenum deflector (see images below) and then replace parts and repair connectors as needed. Remove the air inlet grille to access the plenum water deflector.



Remove the plenum water deflector and add a closed cell foam strip (1/4" tall x 3/8" wide acquired locally) across the entire top of the deflector. Reinstall water deflector and air inlet grille.



Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
D1324	Blower Motor Replacement	0.3 hr

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION