



Service Bulletin

PRELIMINARY INFORMATION

Subject: SES Light On P059F And / Or U0284

Models: 2013 Cadillac ATS

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

On rare occasion, the SES light may be illuminated with either P059F and / or U0284 stored.

Recommendation/Instructions

This could be caused by an obstruction preventing the full travel of the active air shutter.

1. Inspect the upper close-out baffle (surrounding the hood latch) that mates to the upper shutter doors for being out of position and contacting the door. Reposition the baffle as necessary.
2. Inspect the forward harness for being misrouted and contacting the door. Reroute the harness as necessary.

Warranty Information

The correction for this concern may be one of several repairs described above.

For vehicles repaired under warranty, please use the appropriate warranty labor operation based on the actual cause and repair.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION