

Instrument Cluster Reprogramming

VN, VAH, VHD, VT

FSB 381-047, Instrument Cluster Reprogramming

(November 2012)

Certain VN models built, between January 1, 2004 thru April 30, 2011, may experience a pop up in the cluster indicating "Trailer Marker Lamp" circuit condition which contains an active (DTC) MID 216 PSID 49. The "Trailer Marker Lamp" pop up is incorrect for the (DTC) MID 216 PSID 49. This DTC is due to a "Tractor Marker Lamp" circuit condition.

To resolve this issue follow the procedure below:

You must read and understand the precautions and guidelines in Service Information, group 30, "General Safety Practices, Electrical and Electronics" before performing this procedure. If you are not properly trained and certified in this procedure, ask your supervisor for training before you perform it.

Repair

- 1 Reprogram the Instrument Cluster, MID 140
- 2 Verify proper Instrument Cluster operation. Check that the incorrect pop up message no longer appears.

Reimbursement

This repair may be eligible for reimbursement if a product failure was experienced within time and mileage limits of the applicable Warranty coverage. Reimbursement is obtained via the normal claim handling process.	
Claim Type (used only when uploading from the Dealer Bus. Sys.)	01
Labor Code	
Primary Labor Code	38114-2-00 0.4 hrs.
Causal Part	994793

Volvo Trucks North America engages in a comprehensive program of testing and evaluating to provide the best possible product. Volvo Trucks North America however, is not committed to, or liable for updating existing vehicles.