

[Translate](#)


ROADSTER 2009-4 Engine Performance Optimization Rev1_000042888_WQC61Y09S01_en

Product: Roadster
Bulletin type: Quality
Bulletin no: 2009-4 (rbg2009-005_rev1 en SH)
Revision no: 1
Revision date: December 21, 2012
Campaign no.: 2008-0008
 2009-0004
Publication date: September 28th, 2009
Subject: Engine performance optimization

YEAR	MODEL	MODEL NUMBER	SERIAL NUMBER
2008	Spyder™ GS SM5 and SE5	All	See attached list
2009	Spyder™ GS SM5 and SE5	All	See attached list

This bulletin has been superseded by:

Safety Campaign Bulletin 2010-12

(Campaign numbers on this bulletin are no longer active)

PROBLEM

A small quantity of vehicles may run poorly between 3000 RPM and 4000 RPM AFTER the ECM software update included in the DPS safety recall was carried out (Roadster *WARRANTY BULLETIN 2009-2*). This situation may occur when vehicle is ridden at constant RPM in any gear.

SOLUTION

- A) Update ECM software with the new improved version.
- B) Install a new EVAP canister vent hose.

A) PARTS REQUIRED

description	p/n	qty
ECM calibration update file	219 800 145.FC	1 Included in B.U.D.S. v2.3.26

B) PARTS REQUIRED

NOTE: These parts must be ordered.

description	p/n	qty	SOLD IN PACK OF
Vent hose (formed)	709 000 277	1	1
Corrugated tube	513 033 412	1	1
Oetiker clamp	293 650 047	1	5
Locking tie	293 750 008	2	10
Grommet	293 720 087	1	1