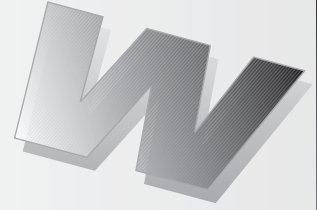


**QUALITY****ROADSTER  
WARRANTY  
Bulletin**

► **NOTE: Repair only if described symptoms exist or are noticed.**

Campaign no.: 2008-0008  
2009-0004

September 28<sup>th</sup>,  
2009

Subject: **Engine performance optimization**

No. **2009-4**

**REVISION 1**  
**December 21, 2012**

YEAR	MODEL	MODEL NUMBER	SERIAL NUMBER
2008	Spyder™ GS SM5 and SE5	All	See attached list
2009	Spyder™ GS SM5 and SE5	All	See attached list

**This bulletin has been superseded by:  
Safety Campaign Bulletin 2010-12  
(Campaign numbers on this bulletin are no longer active)**

## PROBLEM

A small quantity of vehicles may run poorly between 3000 RPM and 4000 RPM after the ECM software update included in the DPS safety recall was carried out (Roadster *WARRANTY BULLETIN 2009-2*). This situation may occur when vehicle is ridden at constant RPM in any gear.

## SOLUTION

A) Update ECM software with the new improved version.

B) Install a new EVAP canister vent hose.

## A) PARTS REQUIRED

DESCRIPTION	P/N	QTY
ECM calibration update file	219 800 145.FC	1 Included in B.U.D.S. v2.3.26

## B) PARTS REQUIRED

NOTE: These parts must be ordered.

DESCRIPTION	P/N	QTY	SOLD IN PACK OF
Vent hose (formed)	709 000 277	1	1
Corrugated tube	513 033 412	1	1
Oetiker clamp	293 650 047	1	5
Locking tie	293 750 008	2	10
Grommet	293 720 087	1	1