



Service Bulletin

PRELIMINARY INFORMATION

Subject: Front Door Wind Noise

Models: 2013 Chevrolet Sonic

Condition/Concern

Some customers may comment on front door wind noise.

Recommendation/Instructions

The wind noise may be coming from the die relief notch in the door. Cover the notch with tape following the procedure below:

1. Lower the front door window.



2. Carefully pull down the upper rear corner of the glass run channel weatherstrip.
3. Cut a piece of Posi-Seal Plus™ approximately 50 mm X 40 mm long.





4. Apply the tape over the die relief notch (arrows) making sure not to cover the small gage notch (circled). Refer to the photos above.
5. Reinstall the upper rear corner of glass run channel weatherstrip.

Parts Information

Part Number	Description	Qty	Material Allowance
KT13080*	Posi-Seal Plus™–Kent (2½ x 2½ Pads)	1	\$2.50 Per Vehicle

*This product is currently available from Kent Industries (1-888-YES-KENT).

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
B6835*	Install Tape to Correct Front Door Wind Noise	0.2 hr

*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION