



PERFORM THE PROCEDURE OUTLINED IN THIS SERVICE INFORMATION ON ALL AFFECTED VEHICLES BEFORE CUSTOMER DELIVERY OR THE NEXT TIME THEY ARE IN THE SHOP FOR MAINTENANCE OR REPAIRS.

SUBJECT

Service Action: CIC - Install Navigation Road Map Database 2013

MODEL

E70

E71

E82

E84

E88

E89

E92

E93

F06

F12

F13

F25

F30

Vehicles with option 609 (Navigation System Professional, CIC)

SITUATION

Before delivering affected vehicles to the customer, the Car Information Computer (CIC) road map database 2013 must be installed onto the CIC internal Hard Disc Drive (HDD).

Note: The INITIAL enabling code “FSC CIC map, N. America 2013 INITIAL” is necessary to start the installation process and to activate the road map database.

AFFECTED VEHICLES

This Service Action involves E70, E71, E82, E84, E88, E89, E92, E93, F06, F12, F13, F25 and F30 vehicles which were produced from March 2012 to December 2012.

In order to determine whether a specific vehicle has had this Service Action completed or is affected by this Service Action, first check the B-pillar label for code number **628**. If code number **628** has been punched out, the campaign has already been performed. If code number **628** has not been punched out, it will be necessary to utilize the "Service Menu" of DCSnet (Dealer Communication System) or the Key Reader. Based on the response of the system, either proceed with the corrective action or take no further action.

PROCEDURE

Step 1: Check the "in-service" date of the affected vehicle in the DCSnet Warranty Vehicle Inquiry.

- If the vehicle's in-service date is **before** November 1, 2012, **no further action is required.**
- If **on or after** November 1, 2012, the vehicle is:

A "new vehicle in stock" (no in-service date in DCSnet); or

The vehicle has an in-service date in DCSnet **on or after** November 1, 2012. Perform Step 2.

Step 2: Check the installed road map database using the Key Reader.

- If the Key Reader shows "*Road Map North America Premium 2013*," **no further action is required.**
- If the key reader shows "*Road Map North America Premium 2012*," **refer to and perform the attached installation procedure.**


PARTS INFORMATION

Part Number	Description	Quantity
65 90 2 304 602	Enabling Code, FSC CIC map, N. America 2013 INITIAL	1
65 90 2 344 157	2013 CIC USB Dealer	1

One (1) reusable USB flash drive stick with the CIC navigation road map database 2013 will be shipped to every BMW center through the Automatic Tool Shipment Program.

IMPORTANT: Since parts are limited, additional USB flash drive sticks with the CIC navigation road map database 2013 should only be ordered if really necessary.

LABEL INSTRUCTIONS

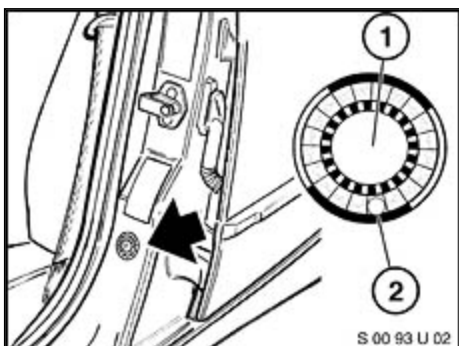

This Service Action has been assigned code number **628**. After the vehicle has been checked and/or corrected, obtain a label (SD 92-417) and:

- Emboss your BMW center warranty number in the middle of the label (1);
- Punch out code number **628** (2), printed on the label; and

C. Affix the label to the **B**-pillar as shown.

If the vehicle already has a label from a previous Service Action/Recall Campaign, affix the new label next to the old one. Do not affix one label on top of another one, because a number from an underlying label could appear in the punched-out hole of the new label.

WARRANTY INFORMATION

The repair described in this bulletin is covered under warranty regardless of time or mileage.

Reimbursement for this Service Action will be via normal claim entry utilizing the following information.

Defect Code: **00 65 61 02 00**

Step 1 Only

Labor Operation:	Labor Allowance:	Description:
00 61 532	1 FRU	After checking the in-service date of the vehicle, no further action is required.

or

Step 2 – Part A Only (Vehicles with the Road Map North America Premium 2013 version already installed)

Labor Operation:	Labor Allowance:	Description:
00 61 533	1 FRU	Determine the “installed” CIC NAV road map version via the Key Reader; no further action is required.

or

Step 2 – Part B Only (Vehicles with the Road Map North America Premium 2012 version installed)

Labor Operation:	Labor Allowance:	Description:
00 61 534	3 FRU	Determine the “installed” CIC NAV road map version via the Key Reader and install CIC NAV road map database 2013.

Labor operations 00 61 532, 00 61 533 and 00 61 534 are Plus labor operations.

NOTE: Only one of the labor operation listed above can be claimed!

ATTACHMENTS

view PDF attachment [B651512 Attachment](#).

[Copyright © 2012 BMW of North America, LLC]