



SUBJECT**Headunit-High: Navigation to an iPhone Address Is Inoperative****MODEL**

F01

F02

F02H

F07

F10

F10H

F30H

Produced from July 2012 to December 2012

With option 609 (Navigation System Professional, HU-H)

and

Without option 6VA (CIC contribution)

SITUATION

The route guidance to an address selected from the iPhone address book is inoperative.

CAUSE

The navigation system integrated into the Headunit-High (HU-H) is not accepting addresses from the iPhone address book when the state (part of the address) is stored in the abbreviated form (e.g., NY instead of New York).

CORRECTION**Do not replace parts for this issue.**

1. Program the vehicle using ISTA/P 2.48.1 or later.

Note that ISTA/P will automatically reprogram and code all programmable control modules that do not have the latest software.

2. Complete all of the post-programming work as indicated in the ISTA/P Final Report. This includes performing diagnosis and clearing faults with ISTA, if necessary.

For information on programming and coding with ISTA/P, refer to CenterNet / Aftersales Portal / Service / Workshop Technology / Vehicle Programming.

Note: When the ISTA system message displays: Battery voltage only “XX.XX” V. Please connect charger. Please note the displayed battery voltage reading in the repair order comments section. This documentation is not necessary when part of an approved Technical Service repair procedure; the battery charger is required to be attached before performing the Vehicle Test.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty.

Defect Code: **65 12 58 02 00**

Labor Operation:	Labor Allowance:	Description:
00 00 006	Refer to KSD2	Performing “vehicle test” (with vehicle diagnosis system – checking faults)
and if necessary, also		
61 21 528	Refer to KSD2	Charging battery
and		
61 00 730	Refer to KSD2	Programming/encoding control unit(s)

Labor operation code 00 00 006 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance. Enter the Chassis Number, which consists of the last 7 digits of the Vehicle Identification Number (VIN). Click on the “Search” button, and then enter the applicable flat rate labor operation in the FR code field.

If a control module fails to program correctly or initializations are required, the additional work must be claimed with separate labor operations under the defect code listed above, refer to KSD2.

[Copyright © 2012 BMW of North America, LLC]