

Updates (RVU)

Model Year	Model	Engine	Complaint	Module Part #	Updated Software	RVU #	CD Number	SVM Unit
					Level			
2010	Tiguan, Passat, CC, Eos	2.0L CCTA CBFA	Coolant Pump Activation	06J 906 021	6992	24R9	N/A	3356
				06J 906 021C	6993			
				06J 906 026DA	6987			
				06J 906 026DP	6988			
				06J 906 026DN	6989			
				06J 906 026DR	6990			
				06J 906 021B	6991			
06J 906 026DQ	6995							
2009- 2010	Jetta (A5 and A6) Golf, Rabbit, Jetta SportWag en	2.5L CBTA CBUA	Rough Running behavior and cold start issues	07K 906 055BE	9213	24W4	N/A	3565
				07K 906 055BD	9212			
				07K 906 055BC	9210			
				07K 906 055BB	9211			
				07K 906 055AG	9970			
				07K 906 055AF	9970			
				07K 906 055AJ	9970			
				07K 906 055AH	9970			
				07K 906 055M	9970			
				07K 906 055N	9970			
				07K 906 055P	9970			
				07K 906 055Q	9970			
				07K 906 055G	9217			
				07K 906 055F	9216			
07K 906 055A	9214							
07K 906 055	9215							
2010	Touareg	3.6L BHK	Catalyst Monitoring	03H 906 032GQ	9893	24X5	N/A	35B1

Updates (RVU)

Model Year	Model	Engine	Complaint	Module Part #	Updated Software		RVU #	CD Number	SVM Unit
					Level				
2011-2012	Jetta	2.0L CBPA	Engine Idle Quality when the A/C compressor is activated	06G 906 055B	1111	24X7	N/A	3522	
				06G 906 055C	1110				
				06G 906 055R	1105				
				06G 906 055S	1106				
2010-2013	Passat CC	2.0L CCTA CBFA	Current ECM/TCM programming may cause stumble depending on driving conditions	06J 906 027AB	7378	24X8	N/A	3733	
				06J 906 027AC	9970				
				06J 906 027F>06J 906 027FE	3952				
				06J 906 027G>06J 906 027FD	3951				
				02E 300 058N	3509				
2010-2012	Jetta, Jetta SportWagen, CC, Eos, Golf, GTI, Beetle	ALL	While braking and down shifting in Tiptronic mode the transmission does not respond accordingly	02E 300 054M>02E 300 057B	2730	37D2	N/A	364B	
				02E 300 057B	2731				
				02E 300 054J>02E 300 057A	2705				
				02E 300 054L>02E 300 057C	2724				
				02E 300 057C	2724				
				02E 300 057B>02E 300 057B	2730				
				02E 300 054C>02E 300 054C	2806				
02E 300 058E>02E 300 058E	2805								
2011	Jetta	ALL	The A/C system might not cool the vehicle fast enough or Key to lose adaption	5C0 820 047H>5C0 820 047M	103	87C6	N/A	345F	
				5C0 820 047J>5C0 820 047N	103				
				5C0 820 047K>5C0 820 047P	103				
				5C0 820 047L>5C0 820 047Q	103				

Updates (RVU)

<u>Model Year</u>	<u>Model</u>	<u>Engine</u>	<u>Complaint</u>	<u>Module Part #</u>	<u>Updated Software Level</u>	<u>RVU #</u>	<u>CD Number</u>	<u>SVM Unit</u>
2011	GTI, Jetta, Tiguan	ALL	Out dated software in the ELV module could cause the vehicle not to start	5K0 905 861	120	96B7	N/A	3478