

SERVICE CAMPAIGN BULLETIN

CAMPAIGN REF: 012

TITLE : Check the serial number of the Tyre Pressure Monitoring System (TPMS) control unit and replace if necessary

DOCUMENT # : 11 M 031

AFFECTED VEHICLES : 12C Coupe


SITUATION : Quality Engineering at McLaren Automotive have identified that a number of vehicles have been fitted with TPMS control units that potentially can lose communication with the sensor triggers, causing spurious TPMS warning messages to appear in the instrument cluster.

PROCEDURE : Check the TPMS control unit number. If the vehicle is fitted with a control unit that has a serial number between 00001682 & 00002191, the TPMS control unit should be replaced.

REMOVAL:

1. A-RM-02A02-03-004 - Remove/install luggage bin - Rear
2. A-RM-06N06-01-008 - Remove/Install B-Pillar finisher
3. A-RM-06N06-01-008 - Remove/Install B-Pillar finisher
4. A-RM-06N06-01-005 - Remove/install rear quarter trim
5. A-RM-06N06-01-003 - Remove/install carpet - fuel cell & bulkhead
6. A-RM-05M01-01-007 - Remove/install false floor - Electric city
7. Inspect TPMS module serial number (1). Control units with a serial number between 00001682 & 00002191 should be replaced.
8. If the TPMS control unit requires replacement, the serial number must be entered into the Retailer Comments box (2) within the Work Package.

Care Point: Do not enter any other information or comments in this section please. Failure to provide this information will result in a delay of the warranty claim being authorised.

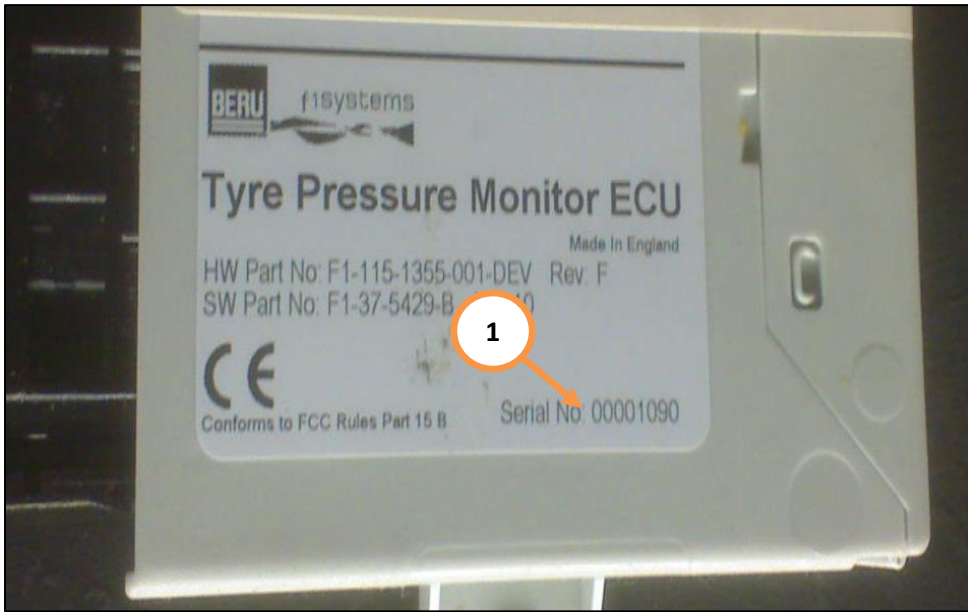

Comments

Customer Comments (cannot be greater than 2000 characters)	Carried out TPMS campaign
Retailer Comments (cannot be greater than 2000 characters)	00001090

INSTALLATION:

1. Install components in reverse order.

Please contact your Regional Aftersales Manager should you have any questions relating to the information contained in this bulletin.

WARRANTY INFORMATION

DESCRIPTION	RESOLUTION CODE	TOTAL REPAIR TIME
Check the TPMS control unit and replace if required	M0M30122A33A9902	2.00 hours

PARTS INFORMATION

PART DESCRIPTION	PART NUMBER	QUANTITY	ORDER PROCESS
Control unit-tyre pressure	11M1437CP	1	Unipart

If the TPMS control unit requires replacement, claim an additional 0.20 hours, using the additional costs section within your campaign work package.
