

Reference SSM59017

S-TYPE / X200

Models XK-SERIES / X100

XJ / X350

Title ZF Transmission – Error message during reprogramming

Category Driveline

Last modified 20-Sep-2012 00:00:00

Symptom 501000 Automatic Transmission Concerns

Issue

Vehicle lines affected: S-TYPE (X202), XJ (X350), or XK (X100) vehicles with ZF transmission

When using SDD to re-configure the TCM as 'Existing Module', the procedure may fail with the following message: "VERONA: SOCKET TX ERROR" and this will leave the TCM in a non-functional state.

Action

Content

If this message appears do not turn the ignition off. Ignore the 'Switch Ignition Off' on screen instruction, leave the ignition on and configure the TCM as a 'New Module'.

If the ignition has been switched off, close the current session, start a new session and configure the TCM as a 'New Module'

If the above fails please contact the local Technical Support hotline for assistance.