

# Service Bulletin

Circolare tecnica - Technisches Rundschreiben - Circulaire Technique - Circular Tecnica

Data: 08 August 2012

Oggetto: **Number plate support fixing**

Prodotto: **F3 675 - F3 ORO**

Following a continuous monitoring of product quality has been decided to update with new motorcycle license plate bracket's fixing that ensure long-term durability. It is therefore necessary replacement on the following chassis numbers:

- **MODEL F3 675 – F3 ORO MY 2012 to a VIN ..V001628** included

## Part that must be ordered:

- N° 4 pieces p/n 8A00B2688 VITE TCEIF M6X1-L14
- N° 4 pieces p/n 80B004898 ROSETTA D15-D6,25-SP1,5
- N° 4 pieces p/n 8000B2710 DADO AUTOBLOC.FLANG.M6X1-CH10-SP7

## Assembly procedure:

Disassembly the original bolts and nuts.

Assembly the new screws p/n 8A00B2688 from the bottom to the top, install the new washers p/n 80B004898 and fix with nuts p/n 8000B2710; torque 10 N/m.



You are kindly asked to carry out the installation of new parts during pre-delivery operations or at the first periodical inspection.

- please refer to the Service Manual for any information not included in this document.

## REIMBURSEMENT PROCEDURE:

- Send the Warranty Claim for the reimbursement of the parts and labour cost.
- Besides the complete data of the motorcycle, please indicate:
  - Type of warranty = GS
  - Number of special warranty = 2770
  - Operational code: R999
  - Labor: 0,3 hour
  - Defect code: 099
- In the notes, please make reference to Service Bulletin N°97.
- The reimbursement to the warranty request will be made via invoice.

Thank you for your co-operation; if you should require any technical support in future, we are at your service.

With best regards  
MV AGUSTA MOTOR S.p.A.  
Technical Service Department