

TECHNICAL BULLETIN

LTB00463NAS1

04 SEP 2012



SECTION: 501-08

Tailgate Window Glass Trim Panel Indentations

AFFECTED VEHICLE RANGE:

Range Rover Sport (LS)

VIN: CA717166 - CA730239
Model Year: 2012

CONDITION SUMMARY:

Situation: The rear tailgate window glass trim panel may appear to be uneven or to have indentations.

Cause: This may be caused by the trim panel fixings being over torqued.

Action: In the event of a customer concern of the above, refer to the Repair Procedure outlined below.

PARTS:

LR013135..... Tailgate fir tree clip Qty: 2

TOOLS:

Refer to Workshop Manual for any required special tools

WARRANTY:

△ **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Finisher – lower screen - modification	76.43.75	0.50	02	LR031187-Dark Atlas LR030911-Atlas


Normal Warranty policies and procedures apply

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

REPAIR PROCEDURE

MODIFY THE TAILGATE WINDOW GLASS TRIM PANEL

1. Refer to Workshop Manual section 501-08 and remove the tailgate window glass trim panel.
2. Use a suitable tool to remove and discard the two fir tree clip inserts.

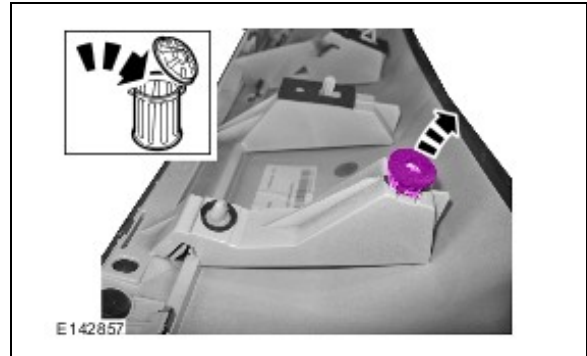

3. Install the two new fir tree clips.



4. Refer to Workshop Manual section 501-08 and install the tailgate window glass trim panel.