



# Service Bulletin

File in Section: -

Bulletin No.: PIC5708B

Date: September, 2012

## PRELIMINARY INFORMATION

**Subject:** Check Engine Lamp With DTC P0111

**Models:** 2012-2013 Chevrolet Volt

**This PI was superseded to update recommended field. Please discard PIC5708A.**

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern:

Customer comes in the dealer with a Check Engine Lamp with a current or history code P0111.

**Note:** If other MAF sensor DTCs is set, please disregard this PI.

### Recommendation/Instructions:

If you experience this DTC, please don't replace the B75B Mass Airflow Sensor, Intake Air Temperature sensor, or the ECM. Engineering is working on the concern and the sensor replacement will not resolve the concern. This PI will be updated when the fix is available.

Verify MAF sensor connector is fully seated and clear the DTC.

**Important:** To fully clear the code, please be sure the engine is started before releasing the vehicle to the customer. The engine can be started by putting the vehicle in propulsion mode and then opening the hood.

### Warranty Information:

For vehicles repaired under warranty use:

| Labor Operation | Description  | Labor Time |
|-----------------|--|------------|
| J9999           | Powertrain Controls — Check MAF Sensor connections and clear DTCs per PIC5708B | 0.2        |

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.