



# Service Bulletin

File in Section: -

Bulletin No.: PI0705B

Date: September, 2012

## PRELIMINARY INFORMATION

**Subject:** Malfunction Indicator Lamp (MIL) On, Multiple 5 Volt Reference DTCs Set

**Models:** 2012-2013 Chevrolet Impala

This PI is being revised to add the 2013 model year and remove the VIN breakpoint. Please discard PI0705A.

### Condition/Concern

Some customers may comment on a malfunction indicator lamp on.

Technicians may find one or more of the following DTCs set: P057C, P0641, P0462, P0651, P0697, P06A3, P2227, P2228, P2230, P0178, P2122, P2127, P2138.

### Recommendation/Instructions

DO NOT REPLACE THE ECM or the ACCELERATOR PEDAL until the following interconnects have been verified.

Inspect for proper wiring connections (properly seated, no bent terminals, no contamination) at X101, X111 and X115.

Once these have been verified and the condition still exists, follow SI diagnostics.

Refer to SI for proper connector locations.

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
N6654	Connector Reconnection	Use Published Labor Operation Time