> Constellation
> Heritage

Western Star Service Bulletin

Description of Revisions: This bulletin replaces the version dated December 2010. A new turbo outlet pipe support bracket has been added to **Table 1**, and the replacement procedure has been updated to include the new bracket.

General Information

If you have a failed exhaust bellows on an EPA07 engine installation, replace it with a new style bellows, and two new matching clamps. Also, if vehicle currently has the early style turbo outlet pipe support bracket (p/n 04-24627-000) installed, replace it with a revised part (p/n 04-29024-000) that provides better support and reduces vibration. Refer to **Table 1** for the original and replacement part numbers.

NOTE: The two part numbers for each size clamp are only for packaging purposes. The clamps are the same for both part numbers, so clamps with either number can be used together.

EPA07 Exhaust Bellows Replacement Parts			
Description	Original Part Number	Replacement Part Number	New Clamp Part Number
5-Inch Bellows	A04-25022-018	04-28522-000	TCX AMS015AM (2 ea) or
			TCX AMS015 (2 ea)
4-Inch Bellows	A04-25922-018	04-28578-000	TCX AMS014AM (2 ea) or
	A04-26193-018		TCX AMS014 (2 ea)
Turbo Outlet Pipe Support Bracket	04-24627-000	04-29024-000	—

Follow the procedure below, and refer to the Western Star Workshop Manual for vehicle specific information.

Table 1, EPA07 Exhaust Bellows Replacement Parts

Replacement

- 1. Remove the exhaust piping between the turbo and aftertreatment device (ATD).
- 2. On the workbench, remove the exhaust bellows from the exhaust piping. Do not damage the piping.

NOTE: The following step, and its substeps, is to be done without the bellows installed. This will align the pipes so that the bellows can be installed correctly.

3. Check and align the ATD inlet pipe with the turbo outlet pipe.

- 3.1 Install the ATD inlet pipe on the ATD.
- 3.2 Install the turbo outlet pipe on the turbo.
- 3.3 Measure the vertical distance between the pipe ends and the frame rail. See **Fig. 1**. This measurement must be the same for both pipe ends.
- 3.4 Measure the horizontal distance between the pipe and the frame rail. See **Fig. 2**. This measurement must be the same for both pipe ends.
- 4. Once the pipes are aligned and concentric, measure the distance between the ATD inlet pipe and turbo outlet pipe. See Fig. 3.

The minimum distance should be 13-3/8 inches (340 mm), and the maximum should be 14-3/8 inches (365 mm). If they are too close together cut an equal amount off of each pipe to meet the minimum distance.

5. Using a yellow paint pen mark the pipes 1.5 inches (38 mm) in from the end of each pipe. These two marks will be used to center the bellows between the two pipes.

Western Star Service Bulletin



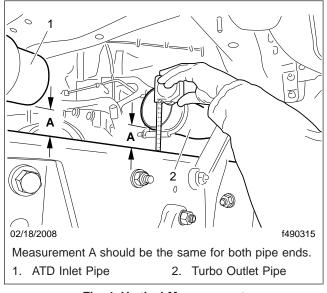


Fig. 1, Vertical Measurement

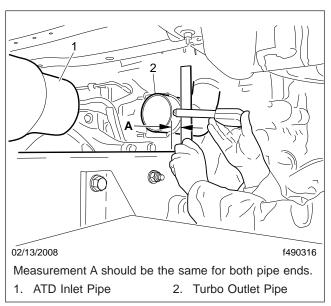


Fig. 2, Horizontal Measurement

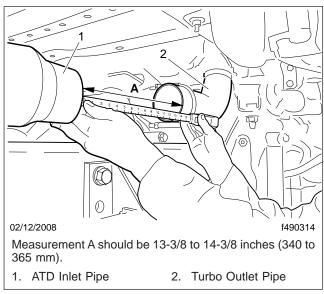


Fig. 3, Measuring Between the Pipes


- 6. Once the pipes are correctly aligned and separated at the correct distance, secure the ATD inlet pipe.
- 7. Remove the turbo outlet pipe from the truck.
- 8. Slide the slip clamp, with the retaining ring and graphite gasket ring, on the ATD inlet pipe. See Fig. 4 for proper installation.
- 9. Slide the new bellows onto the ATD inlet pipe as far as it will go. See Fig. 5.

> Constellation

> Heritage

49-*1*

Western Star Service Bulletin

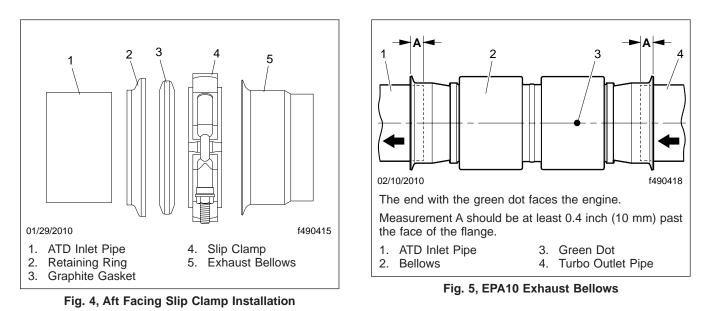

10. Install the slip clamp with the retaining ring and graphite gasket ring onto the turbo outlet pipe. See Fig. 6 for proper installation.

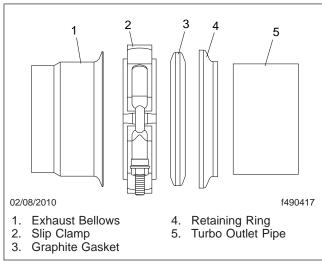


Fig. 6, Forward Facing Slip Clamp Installation

- 11. Slide the outlet end of the turbo outlet pipe into the bellows, and align the other end to the turbo.
- 12. If not already replaced, remove the old style turbo outlet pipe support bracket (04-24627-000) from the frame rail and discard it.
- 13. Install the new support bracket (04-29024-000). Tighten 103 lbf-ft (140 N·m).
- 14. Using the original clamp, secure the turbo outlet pipe to the turbo and pipe support bracket.
- 15. Using the yellow marks, center the bellows between the exhaust pipes. Verify that the pipe is inserted at least 7/16 inch (10 mm) past the face of the flange. See Fig. 5.

Western Star Service Bulletin

> Constellation> Heritage

16. Install the slip clamps on the bellows. Tighten the slip clamps 15 lbf-ft (20 N-m).

17. Start the engine and check for exhaust leaks. Tighten any clamps as needed.

Warranty

This bulletin is informational only. Warranty does not apply.