



Service Bulletin

File in Section: -

Bulletin No.: PIP4924A

Date: May, 2012

PRELIMINARY INFORMATION

Subject: SES Light And Misfire With Injector Codes

Models: 2009 - 2012 Buick Enclave
 2009 - 2012 Buick Lacrosse
 2010 - 2012 Cadillac CTS
 2009 - 2012 Cadillac SRX STS
 2010 - 2012 Chevrolet Camaro
 2010 - 2012 Chevrolet Equinox
 2012 Chevrolet Impala
 2009 - 2012 Chevrolet Malibu
 2009 - 2012 Chevrolet Traverse
 2009 - 2012 GMC Acadia
 2010 - 2012 GMC Terrain
 2009 - 2010 Saturn Outlook
 2009 - 2010 Saturn Vue
 With 2.8 LAU, 3.0L LF1, LFW and 3.6L LLT, LFX engines

This PI was superseded to update model and model years. Please discard PIP4924.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern:

SES light and misfire with any of these injector related codes:

P0201 P0202 P0203 P0204 P0205 P0206 P0261 P0262 P0264 P0265 P0267 P0268 P0270 P0271 P0273 P0274
 P0276 P0277 P2146 P2149 P2152 P2155 P216A P216D

Recommendation/Instructions:

Carefully inspect the fuel injector wiring harness for rub through or internal wire opens.

Some common spots are against the intake plenum, at valve cover bolts, against the fuel line and on the side of the head under the plenum.

If this concern is found repair or replace the injector harness as needed.

Also refer to the latest version of PI0631 for other under-hood wire chafe locations.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.